



WILKINSON/ACE
ELECTRICAL & MECHANICAL CONTRACTORS

POCKET SAFETY HANDBOOK





Since our modest beginning in 1945, Wilkinson Electric & Ace Mechanical has been deeply concerned about safety and general welfare of our Employees. "Safety is No Accident" has been a part of our company for more than two decades. To again focus the attention of everyone who is a part of Wilkinson Electric & Ace Mechanical, we have adopted a Risk Management Program for all Employees and Subcontractors. It is our sincere objective to eliminate all occupational accidents and incidents on our projects. To compromise this absolute objective with a tolerance of any degree is socially irresponsible. This formalized plan becomes a part of The Wilkinson Electric & Ace Mechanical standard by which each of us should be judged. We expect everyone involved with us to adopt these standards as their own.

Scott P. Wilkinson
President

WILKINSON/ACE

ELECTRICAL & MECHANICAL CONTRACTORS

STANDARDS OF CONDUCT

Commonly accepted standards of conduct help maintain good relationships between people. They promote responsibility and self-development. You can avoid misunderstandings, friction and disciplinary action by avoiding thoughtless or wrongful acts, such as the following:

EMPLOYEES SHOULD UNDERSTAND THAT THIS IS NOT AN ALL-INCLUSIVE LIST OF ALL STANDARDS OF CONDUCT.

1. Failure to perform work. Inefficient performance, incompetence or neglect of work.
2. Willful refusal to perform work as directed (insubordination).
3. Negligence in observing safety regulations, poor housekeeping or failure to report On-the job injuries or unsafe conditions.
4. Unexcused or excessive absence or tardiness.
5. Failure to call superintendent within one hour after the scheduled start time on each day of an absence.
6. Unwillingness or inability to work in harmony with others. Discourtesy, irritation, friction or conduct creating disharmony.
7. Horseplay, fighting, threatening, intimidating or coercing others on the job site or Company premises.
8. Bringing unauthorized weapons, firearms or explosives on the job site or Company premises.
9. Harassing or discriminating against another individual.
10. Failure to be prepared for work by wearing the appropriate construction clothing or bringing the necessary tools.
11. Violation of any other commonly accepted reasonable rule of responsible personal conduct.

INTOLERABLE OFFENSES

Certain Employee conduct may be so intolerable as to justify immediate discharge. Intolerable offenses and actions will include, but will not be limited to:

1. Dishonesty or falsification in any form or degree.

2. Damage, loss or destruction of Company. Employee, or customer property due to willful or negligent act.
3. Unauthorized possession, removal or use of property belonging to the Company, customers or other Employees.
4. Being under the influence of or possession of alcoholic beverages, intoxicants or illegal drugs on Company premises.
5. Being under the influence of alcohol where the alcohol level is .02 or greater.
6. Safety violations that endanger other Employees.
7. Refusal to wear safety equipment.
8. Removing and/or crossing through red tape/red danger tape and/or working inside red tape or red danger tape without authorization.

ENFORCEMENT /DISCIPLINE

For minor offenses with minor consequences, an employee will be expected to agree to improve behavior. Offenses may later be recorded as a warning.

Suspension or discharge will result from major offenses, those with serious or costly consequences, or for repeated minor offenses of minor consequences for which an Employee shows a lack of responsible effort to correct deficiencies.

Discipline is intended to preserve good conditions for other Employees and encourage each Employee to be a responsible and conscientious person. Violations will be kept on file for a period of six months from the date of violation.

Wilkinson Electric and Ace Mechanical (WA) Employees shall be issued a hazardous act citation for the following.

1. Violating WA safety policy
2. Unsafe acts
3. Accidents caused due to negligence
4. A warning will be issued & 1000 hours deducted from the employee's safety hours when the employee is exposed to 12 feet or more of fall or is closer than 4 feet from the edge when fall protection is not provided.

*** All new hires will receive verbal warning for safety violations during orientation.**

ENFORCEMENT/DISCIPLINE FOR SAFETY VIOLATIONS ONLY

First Offense- Employee will receive a written warning.
Second Offense- Employee will receive a two (2) day suspension without pay.
Third Offense- Employee will be discharged.

AT-WILL EMPLOYMENT POLICY

WA reserves the right to discontinue employment at any time for any reason or no reason, with or without notice. Employees also reserve the same right.

SUBCONTRACTOR

STANDARD OF CONDUCT

Commonly accepted standard of conduct help maintain good relationships between people. They promote responsibility and self-development. You can avoid misunderstandings, friction and disciplinary action by avoiding thoughtless or wrongful acts, such as the following:

SUBCONTRACTORS SHOULD UNDERSTAND THAT THIS IS NOT AN ALL-INCLUSIVE LIST OF ALL STANDARDS OF CONDUCT.

1. Failure to perform work, inefficient performance, incomplete or neglect of work.
2. Willful refusal to perform work as directed (insubordination).
3. Negligence in observing safety regulations, poor housekeeping, or failure to report on-the-job injuries or unsafe conditions.
4. Unexcused or excessive absence or tardiness.
5. Failure to call Superintendent of manager within one hour after the schedule start time on each day of absence.
6. Unwillingness or inability to work in harmony with others. Discourtesy, irritation, friction or conduct creating disharmony.
7. Horseplay, fighting, threatening, intimidation or coercing others on Company premises.
8. Bringing unauthorized weapons, firearms or explosives on Company premises.
9. Harassing or discriminating against another individual.
10. Failure to be prepared for work by wearing the appropriate construction clothing or bringing the necessary tools.
11. Violation of any other commonly accepted reasonable rule of responsible personal conduct.

INTOLERABLE OFFENSES

Certain Employee conduct may be so intolerable as to justify immediate discharge. Intolerable offenses and actions will include, but will not be limited to :

1. Dishonesty or falsification in any form or degree.
2. Damage, loss or destruction of Company, Employee, or customer property due to willful or negligent acts.

3. Unauthorized possession, removal or use of property belonging to the Company, customer or other Employees.
4. Being under the influence of or possession of alcoholic beverages, intoxicants or illegal drugs on Company premises.
5. Being under the influence of alcohol where the alcohol level is .02 or greater.
6. Safety violation that endanger other Employees.
7. Refusal to wear safety equipment.
8. Removing and/or crossing through red tape/red danger tape and/or working inside red tape or red danger tape without authorization.

ENFORCEMENT/DISCIPLINE

For minor offenses with minor consequences, a Subcontractor or Employee will be expected to agree to improve behavior.

Removal from the project could result from major offenses, those with serious or costly consequences, or for repeated minor offenses of minor consequences for which the Employee shows a lack of responsible effort to correct deficiencies.

Discipline is intended to preserve good condition for other Subcontractors or Employees and encourage each Employee to be a responsible and conscientious person. Violations will be kept on file for a period of six months from the date of violation.

WORKPLACE VIOLENCE

The safety and security of our employees, customers, and the general public are of vital importance. Therefore, the Company has a “zero tolerance for violence” policy. Subcontractors displaying or threatening any violence in the workplace are subject to immediate termination. No talk of violence or joking about violence will be tolerated.

We define “violence” to include physically harming another, shoving, pushing, harassment, intimidation, coercion, brandishing weapons, and threats or talk of violence.

It is everyone’s business to prevent violence in the workplace. Subcontractors can help by reporting anything in the workplace that could indicate a coworker is in trouble. Often, employees are in a better position than Management to know what is happening with those around them.

If a violent incident occurs on Company property, employees are not expected to endanger their own lives or health to help others but will not be penalized for engaging in such action if such action results in violating other workplace policies and/or procedures. Employees should call the police, if necessary.

SUBCONTRACTOR’S RESPONSIBILITIES

All Subcontractors and their Employees are required to comply with WA Safety and Drug Policies, Company Rules and all the OSHA Construction Standards along with all other state and local safety requirements while working on WA sites or on Company premises.

PROCEDURE FOR DEALING WITH THE SAFETY OF SUBCONTRACTORS

This policy has been developed to assist the Strategic Business Unit (SBU) leaders, Project Managers, and Superintendents in dealing with the safety and health of WA Subcontractor prior to commencing work.

1. Emphasize to the Subcontractor the importance of having a good safety program.
2. Explaining how it benefits themselves and WA. Emphasize that their performance will be evaluated when being considered for further projects.
3. Request a copy of each Subcontractor’s safety program. For those who do not have a safety program explain the following:
 - a. WA, for a fee, will help them develop a program. (If it is in the best interest of the Company)
 - b. A Utah Occupational Safety and Health Administration (UOSHA) Consultant will help them develop a program free of charge.
 - c. Contractors who don’t have a safety program and have no intention of developing one, are required to adopt WA’s program for the duration of the project.
4. WA’s Safety Director and SBU leader will review the Subcontractor’s list and determine from which Contractor WA should request a summary of their citation history.
5. Once the citation summary has been received, the Safety Director and SBU leader(s) will review it to determine possible problem areas that need addressing.
6. Require each subcontractor to have a designated safety representative.
7. In addition to the guidelines in the WA Handbook, the following guidelines are to be followed to protect WA Construction from penalties under the Multi-Contractor clause and potential lawsuits from Employees other than WA.
 - a. The Supervisor and/or Employees of Subcontractors who refuse to comply will be removed from the project and not allowed to return until they are willing to comply.
 - b. The following items must take place for Contractors who refuse to comply with the safety and health regulation:

1. First Warning - Issue a verbal written warning.
11. Second Warning - Issue a written warning if it is a serious violation, the work will be stopped and the problem corrected. The stopped work will be noted on the warning notice.
111. Third Warning – For a serious violation, again, work will be stopped.
- 1V. After the third warning has been issued, copies of all three warnings will be sent to your insurance carrier along with a letter of noncompliance.
- V. If the Subcontractor refuses to stop work, document it, then notify the Project Manager, SBU leader, and/or Safety Director immediately.
- V1. Fourth Warning – The contractor is to be removed from site until they are willing to comply. If it is not possible to remove the contractor, the Safety Director and Project Manager will take whatever action is necessary to bring the contractor in compliance, such as call out OSHA, withhold money, etc.

It is important to keep your SBU leaders, Project Managers and Safety Director informed of all problems you are having with your Subcontractor, so the appropriate action can be taken to help the project.

ALL VISITORS

(I.E. Owners, Architects, Engineers, Suppliers, etc.)

1. Check in with the Superintendent before proceeding onto the project.
2. Observe all safety rules and regulations-I.E. WA Safety and Drug Policies, the Occupational Safety and Health Construction Standards and all other state and local safety requirements.

TEMPORARY HELP

When using the Employees from a temporary employment service, the job-site must train and document that he/she has been trained in the tasks he/she is to perform. Special attention will be given to the hazards the temporary Employee may encounter. The Employee must be trained in the procedures required to protect him/her-self from those hazards.

PERSONAL PROTECTIVE EQUIPEMNT

All equipment will be inspected daily, documented and made available, upon request.

HARD HATS

1. Hard hats shall be worn correctly at all times, until the ceilings throughout the building are completely finished; all overhead hazards and hazards where there is the possibility of damage to the head from impact from falling objects no longer exist. The only exception to wearing the hard hat correctly are: surveyors, structural steel erectors, equipment operators and welders and then only when welding!
2. Be nonconductive

3. Employees should wear only Company-issued hard hats. These hard hats are Company property and should be returned upon termination of employment along with other Company-issued equipment. Employees shall wear hard hats at all times until the ceilings throughout the building are completely finished and until there are no overhead hazards. Hard hats shall be worn correctly (visor forward) at all times. **Only surveyors, structural steel erectors, heavy equipment operators, and welders while welding may wear hard hats with the visor backward.**
4. Employees may display only Company-approved stickers on hard hats. Company-approved stickers include:
 - AGC logo sticker
 - AGC craft certification stickers
 - Safety sticker issued by the Company
 - Employee name tape
 - Years of service number
 - Project clearance stickers required for entrance on project sites (not project marketing stickers)
 - Craft Leadership Training Program stickers

EYE AND FACE PROTECTION

1. Eye injuries are one of the most frequent causes of injury in the construction industry. The following are the requirements for wearing eye protection .
 - A.Safety glasses with side shields, which are approved by American National Standards Institute (ANSI)Z87, will be required at all times in the construction area with the exception of vehicles and equipment.
 - B.Employees, visitors and vendors are required to wear eye protective gear while in the construction area.
 - C.Face shields, burning goggles, welding helmets and chemical goggles will be provided and required on all activities presenting additional injuries.
2. Mandatory eye protection is required on all construction projects except when the following types of construction cease to exist.

• All types of hammers	• Saws	• Chipping Tools
• Brooms	• Grinders	• Impact Tools
• Drills		• Chemicals
• Hazardous Substances such as insulation, concrete mix and other substances which create hazardous dusts, mists and fumes.		
• Concrete pouring	• Dry-packing	• Grouting
• Welding	• Burning	• Cutting

3. Visitors and vendors who are in construction areas will also be required to wear eye protection. (See Appendix A for proper selection)
4. Subcontractors will be required to wear eye protection when performing the tasks listed in item number one under eye protection.

EAR PROTECTION

Ear protection devices shall be provided and worn whenever it is not feasible to reduce noise levels or duration of exposure.

Duration per days, hrs.	Sound Level dBA slow response	Duration days, hrs.	Sound Level dBA slow response
8	90	1-1/2	102
6	92	1	105
4	95	1/2	110
3	97	¼ or less	115
2	100		

PERMISSIBLE NOISE EXPOSURE (1)

See Appendix J

RESPIRATORY PROTECTION

1. Air-Purifying Respirators shall be supplied and worn on all dusty jobs.
2. Atmosphere-Supplied Respirators shall be supplied when conditions warrant and after consultation with the Superintendent.
3. Half or full face respirators with HEPA filter cartridges must be used when soft cutting or grinding concrete. This requires the employee to have a medical evaluation trauma physician and be trained and fit tested by the safety department.
4. Employees wearing a disposable respirator with two or more straps must be trained and have training documented.

PERSONAL FALL PROTECTION SYSTEMS

1. A full body harness will be worn when working on an elevated platform that is 6 feet above the ground where guardrails are not provided.
2. 100% tie-off is required when working 6 feet or more above solid ground or above a temporary or permanent floor or platform when adequate fall protection is not provided. Except during steel erection; then it is 100% tie-off at 25 feet and above, 30 feet to the inside of a multi-story building. This will require the Employee to use: two lanyards, static line, or life line.

CLOTHING, BOOTS, & GLOVES (Not supplied by the Company)

1. Full-length trousers shall be worn.
2. Shirts with a minimum of T-shirt length sleeve.
3. Leather over the ankle steel-toed boots with heavy sole. (Boots with a non-slip sole are recommended).
4. All Subcontractors will be required to wear leather over the ankle boot with a heavy sole.
5. Gloves shall be worn where protection is needed against concrete, rough or sharp objects, hot materials, other chemicals, caustic or abrasive materials.
6. Tank tops, shirts cut off at the midriff, cutoffs, sweat pants, moon boots, sandals, sneakers, jogging shoes, steel-toed tennis shoes, etc. are prohibited. (Visitors are required to maintain the same dress code.)

GENERAL SAFETY GUIDELINES

EMPLOYEES SHOULD UNDERSTAND THAT THIS IS NOT AN ALL INCLUSIVE LIST OF ALL STANDARDS OF CONDUCT AND SAFETY RULES.

ABRASIVE GRINDING

Abrasive wheel bench or stand grinders must have safety guards strong enough to withstand bursting wheels. Inspect and ring test abrasive wheels before mounting. Always leave wheel in working condition for next user. The tool rest must be 1/8" from grinding wheel.

AIR TOOLS

Secure pneumatic tools to hose in a positive manner with safety clips or retainers to prevent them from being accidentally disconnected or expelled.

COMPRESSED GAS CYLINDERS

1. Cylinder valves shall be closed when work is finished and when cylinders are empty of being moved.
2. Put valve protection caps in place before compressed gas cylinders are transported, moved, stored or when work is finished.
3. Cylinders of compressed gas shall be chained or other wise secured in an upright position while in use or being stored.
4. Oxygen and acetylene regulators shall be in proper working order while in use.
5. Compressed gas hoses shall be free from leaks or poor connection and be neatly wound on hose hangers

6. Oxygen and fuel gases must be
 - a. Stored in an upright position.
 - b. Have the Protective caps on tight
 - c. Be separated a minimum of 20 feet apart or by a wall constructed of non-combustible material 5 feet high with a minimum fire rating of one hour.
7. Place a fire extinguisher approx. 25 ft. (no farther than 75 ft.) from area.

CONCRETE SHORING

Form-work and shoring shall be designed by an engineer or a competent person and constructed to safely support all loads imposed during concrete placement. Drawings or plans of jack layout, form-work, shoring, working decks, and scaffolding systems shall be available at job-site.

EQUIPMENT RENTAL POLICY (Except for Cranes)

1. Include all insurances in rental agreement.
2. If the rental company does not have insurance find out one that does.
3. Send copies of the rental agreement to the Safety & Risk Manager.
4. Damages to Company owned equipment which is \$10,000 or less is to be paid by the project. The \$10,000 deductible will be paid by the job site renting the equipment.
5. Damages to Company owned equipment which is more than \$10,000 will be paid by the Company's insurance.
6. In the event of an accident, submit a full report to include pictures, diagrams, etc. to the Safety & Risk Manager within 24 hours following the incident.
7. Boom trucks are not classified as a crane under 20 tons for this purpose.

CRANES, MACHINERY, AND CONCRETE PUMPS

1. Operators of all heavy equipment (i.e. crane, forklift, backhoe, etc.) must be trained or certified.
2. All machinery shall be shut down with motor off prior to cleaning, fueling, lubricating or repairs.
3. Cranes, rigging and equipment shall be checked before each day's use by the operator. Any defects shall be corrected before use. An inspection log shall be kept on the machine, recording safety checks and proper fluid levels. (See Appendix E for good rigging practices.)

4. Rated load capacities, hand signals, and special hazard warnings shall be conspicuously posted on all equipment.
5. Accessible areas within swing radius of all types of cranes used by WA will be barricaded to prevent Employees from being struck or crushed.
6. Only the operator will be allowed on the crane within the barricaded areas, except when there is a need to talk to the crane operator.
7. The only time an individual will be allowed to talk to the operator is when he/she is able to do so safely.
8. No one will be allowed at any time to eat, sit, stand or ride on any equipment, except the operator.
9. Except where electrical distribution and transmission lines have been de-energized, no part of the crane or its load, concrete pump or its hose, or any other piece of equipment shall be operated within 10 feet of a line rated below 50kV or twice the length of the line insulator when over 50kV. For lines rated over 50kV, the minimum distance between the equipment and the load must be 10 feet plus 4 inches for each additional 1 kV.
10. Only one signal person using proper hand signals shall direct equipment.
11. Crane operators shall not swing loads above areas where others are working, and shall stop use of crane during high winds or lightning storms.
12. Riding the hook, ball, load or equipment buckets is absolutely prohibited.
13. Guidelines For Working Around Power Lines. The following policy is to be implemented when using equipment such as cranes or dump trucks, in and around power lines.
 - A. Notify the power company of your intentions and ask if additional precautions need to be taken.
 - B. Notify the safety department in a timely manner.
 - C. A meeting will be set up between the superintendent and a representative of the safety department in order to put a plan together that will adequately protect personnel and equipment working in the specific area. The plan will also include what to do in case of an emergency.
 - D. Once the plan is adopted and approved, everyone working in that area will be notified with the meeting documented.
 - E. This plan will be on file and made available upon request.
 - F. When working around power lines, extreme caution must be used. For power lines over 50kV, a minimum clearance between the lines and any part of the equipment, i.e. cranes, dump truck, etc. is 10 feet plus 0.4 inches for every 1kV over 50kV.

- G. A person shall be designated to observe clearance of equipment and shall be able, in a timely manner, to warn the operators when it is difficult for the operator to maintain the required clearance.
- 14. If an employee who operates a piece of equipment is involved in an accident, he/she will be retested and evaluated to see if he/she is still competent enough to keep their certification.
- 15. If any part of this policy is violated, disciplinary action will be taken.
- 16. See Appendix C & D, for Crane & Pump truck hand signals.

DISASTER PLANNING

In areas where the seasons historically produce violent weather, (i.e. earthquakes, high winds, fires, floods, etc.) the Supervisor should acquaint himself with the potential of a natural disaster and take every precaution to avoid human or financial loss. Preventative measures, as well as planned reaction to a disaster, are important. A simple but effective plan should be formulated for each. A few, but not all, are:

• *Earthquake* • *Flood Control* • *High Winds* • *First Aid* • *Firefighting*

- 1. Emergency plans for 24 hours a day, seven days a week.
- 2. Notification sequence and communication to Employees.
- 3. Regular contracts with communication medial.
- 4. Utility main shutdown.
- 5. Site Security.
- 6. Site shutdown procedures.
- 7. Outside help (Police, Fire Dept., Utility Co., etc.)

FALL PROTECTION

- 1. When working on or around all unprotected openings, such as openings on walls and floors that are 12 or more inches in their least dimension, and are six feet or more of fall to include ramps, runways, steep and low pitched roofs, and other walkways that may apply, employees must be protected by the use of a guardrail system, safety nets, or personal fall arrest system.
- 2. 100% tie-off or the use of safety nets or guardrail system must be used when working 6 feet or more above solid ground.

3. Leading edge – A leading edge is an edge of a floor, roof, framework, floors or other working surfaces such as a (desk) that is unprotected on the sides and edge when it is not actively under construction. When an individual is constructing a leading edge they must be protected from falling by the use of a guardrail system, safety net or a personal fall arrest system unless it can be demonstrated by other means that can be used safely. If other means are used the project must have a site specific written training program.

4. Wall Openings – Each Employee working on, at, above, or near wall openings (including hose with chutes attached) where the outside bottom edge of the wall opening is 6 feet (1.8m) or more above lower levels and the inside bottom edge of the wall opening is less than 39 inches (1.0m) above the walking/working surface, shall be protected from falling by the use of a guardrail system, a safety net system, or a personal fall arrest system.

5. Excavations – Guardrail systems such as fences or barricades are to be used when the excavation cannot be seen due to plant growth or other visual barriers or when excavation is in remote areas such as wells, pits or shafts and is 6 feet or more in depth.

6. Warning Lines – When a warning line is used on a roof, it must be erected around all sides of the roof area not less than 6 feet back from the edge. The lines may consist of ropes, wires or chains with tensile strength of 500 pounds after being attached to a stanchion. It must be supported so that the sag or lowest point is not less than 34 inches. If the highest is 39 inches, it must be flagged at 6 foot intervals with high visibility. The stanchion must be able to resist tipping over when a force of 16 pounds is applied to it. No Employee will be allowed beyond the warning line unless he/she has work to do in that area. If he/she does have work in that area, the Employee must use a personal fall arrest system, safety monitor, or both.

7. Safety Monitor – In the event a guardrail system cannot be used when working on the leading edge of the roof a safety monitor may be used. If a safety monitor is used, the roof must be less than 50 feet wide. If the roof is more than 50 feet wide a safety monitor/warning line system must be used. The safety monitor must be easily identified.

8. Controlled Access Zones – A controlled access zone is an area clearly marked where leading edge work will take place without the use of a guardrail, safety net, or personal fall arrest system such as overhand brick layering or related work.

- A. When used to control access to areas where a leading edge exists and/or other operations are taking place the controlled access zone shall be defined by a control line, or by any other means that restricts access.

- B. When control lines are used, they shall be erected not less than 6 feet or more than 60 feet, or half the length of the member being erected, whichever is less, from the leading edge.
 - C. The control line shall extend along the entire length of the unprotected or leading edge and shall be approximately parallel to the unprotected or leading edge.
 - D. The control line shall be connected on each side to a guardrail system or wall.
 - E. Control lines shall consist of ropes, wire, tapes, or equivalent materials, and supporting stanchions.
 - F. Each line must be visibly marked at 6 foot intervals.
 - G. Each line must have a minimum breaking strength of 200 pounds.
9. Precast – Employees engaged in the erection of precast, which include but not limited to: wall panels, columns, beams, floor and roof “tees” and related tasks such as grouting and are exposed to six feet or more fall will be protected by a standard guardrail system, safety nets or personal fall arrest system.
 10. Runways, ramps and other walkways will be guarded by a standard railing on all open sides 6 feet or more above floor on ground level.
 11. Stairs having four or more risers will be equipped with a standard tailing.

ELECTRICAL

On many OSHA inspections the majority of violations found are electrical. Following are some of the most common electrical violations found.

1. Extension cords are not to be used as a substitute for permanent wiring. Do not run them through doors without protection.
2. Do not allow cords to be run over by equipment unless properly protected against damage.
3. Do not use household 4 way boxes unless they are waterproof.
4. Make certain they are wired properly.
5. Check for reverse polarity.
6. All outlets must be GFCI protected except for temporary lighting.
7. Splicing/Repairing electrical cords. Do not use electrical tape. Use a vulcanizing tape or a shrink tube.
8. Take all damaged cords out of service when plug ends have pulled away from the outer insulation, or they have cuts or tears in the outer insulation where the inner wires are exposed, or ground pins are missing or broken.
9. Inspect cords weekly and before using.
10. Repairs should be done under the direction of an electrician.

IDENTIFICATION OF POWER TOOLS TEMPORARY POWER CABLES AND EXTENSION CORDS

1. Place some types of contractor identification, i.e. tags, on all power tools, temporary power cables, and extension cords.
2. Notify the Superintendent or Foreman of any power tools, temporary power cables and extension cords that are not in compliance with the National Electrical Code and OSHA Construction Standards so they can be replaced or repaired.
3. If any power tool, temporary power cable or extension cord not in compliance can be identified as to which Contractor it belongs, the contractor will be notified of the violation.
4. If the Contractor fails to correct the violation, a representative of WA will issue a written warning.
5. If, after issuing the written warning, the Contractor does not comply, the power tool, temporary power cable or extension cord must be removed from service by a WA representative.

EXCAVATION AND TRENCHES

1. Walls of trenches and excavations five (5) feet more in depth in which Employees are exposed to danger from moving ground or cave-in shall be guarded by shoring or sloping.
2. Trenches four (4) feet deep or more require adequate means of exit such as a ladder located so as to require no more than 25 feet of lateral travel.
3. Excavations and trenches which are five (5) feet or more in depth and less than twenty (20) feet in depth that do not meet the requirements for type A, B, or C soil the protective systems must be designed by a Registered Professional Engineer (RPE).
4. Excavations and trenches which are twenty (20) feet or more in depth the employed protective system must be designed by a R.P.E.
5. When an excavation or trench requires a R.P.E. to design them, the R.P.E. must be registered in the state for which the excavation and trenching is taking place.
6. The design criteria by R.P.E. for protective systems for the excavation and trenches must be kept at the job-site and contain the following information:
 - A. Be in written form to include the size, type and configuration of materials to be used in the protective system and identify the R.P.E. appointing the design. (See CFR 1926.650 & 651 for further information.)
7. See Appendix M.

FIRE PROTECTION

1. Fire fighting equipment shall be conspicuously located, readily accessible (especially when welding or cutting with a torch), periodically inspected and maintained in operating condition. Report any inoperative or missing equipment to your Superintendent.
2. When welding, cutting or burning, remove the following:
 - a. All combustibles 35 ft. radius
 - b. All flammables 50 ft. radius
 - c. All explosives 100 ft. radius
 - d. When it is impossible to remove the above, a fire watch is required
3. Each office and tool trailer shall have at least one 10lb. ABC fire extinguisher on hand.
4. For proper selection of fire extinguishers see Appendix F.

FLAMMABLE & COMSUTIBLE LIQUIDS

1. Only U.L. or equivalent approved metal containers and portable tanks will be used for storage and handling of flammable and combustible liquids.
2. No more than 25 gallons of flammable or combustible liquids may be stored in a room outside of an approved storage cabinet.
3. Tank storage shall not be located under power lines.
4. Signs with "NO SMOKING WITHIN 50 FT." shall be posted on or near the flammable/combustible storage area.
5. A fire extinguisher with a 20 lb. ABC rating shall be available within 75 feet but no closer than 25 feet during the transfer of flammable liquids.

HAZARD COMMUNICATION

1. The Hazard Communication Standard requires Employers to provide information on all hazardous substances that may be present in the work place. Subcontractors or Vendors bringing hazardous materials on WA premises or job-sites are required to have available Material Safety Data Sheets (MSDS) for that material. The manufacturer of that material is required to provide MSDS with hazardous substances. The Superintendent shall provide Subcontractors and Employees on the project with MSDS at their request.
2. Compile a list of all toxic materials on the project and check the WA Hazard Communication Booklet for Material Safety Data Sheet (MSDS) for each of the hazardous materials. If there are substances not covered in the WA Hazardous Communication Book the Superintendent will notify the Office.
3. Label chemicals properly and keep all containers accurately labeled, identifying current contents.

4. Avoid incompatible storage or storage of chemicals above eye level.
5. In the project Safety Meeting review hazardous materials that are being used on the project and train Employees and Subcontractors in:
 - a. Provisions of the Hazard Communication Standard
 - b. How to detect a chemical exposure.
 - c. Physical and health hazards of chemicals in use.
 - d. Use and availability of Material Safety Data Sheets.
 - e. Safe work practices and personal protective equipment.
6. Detailed records of Employee training shall be maintained to prove that the training requirements have been met.
7. Have upon request:
 - a. Copies of the WA's Written Hazard Communication Program.
 - b. Copies of the OSHA Hazard Communication Standard.
 - c. A list of hazardous chemicals on your job-site.
 - d. Copies of Material Safety Data Sheets for any hazardous material to which your job-site is exposed.
8. Refer to the "Hazard Communication Program" that can be found in the WA Hazard Communication Book.
9. For instruction on how to read Material Safety Data Sheets and labels on containers, see Appendix G.

HOUSEKEEPING

1. Good housekeeping is an indication of an efficiently run job. Keep all projects clean and free of debris and rubbish. Trash piles shall be removed at regular intervals. Containers shall be provided for collection of all refuse.
2. Scrap lumber, pipe, fittings, hoses, weld cables, power cords and all other materials shall be kept clear from work areas, hallways and stairs.
3. Bend over or remove protruding nails.
4. Dispose of lunch and break garbage in trash containers.
5. Store materials and supplies segregated as to size and types. These materials are not to intrude into walkways or traffic ways.
6. Throwing materials over the side from above is not allowed unless signal person is directing.
- 6a. A trash chute must be used when throwing trash or other material over the side of the building when the height is 20 or more feet.
7. Eating allowed in designated areas only as directed by the Superintendent.

LADDERS

1. An employee shall not use a ladder that has been broken, loose or cracked rungs, side rails or braces. If such a condition is noted, remove from service and notify the Superintendent so it can be repaired or replaced.
2. Ladders shall be well secured at the top and sufficient length to extend not less than 36 inches above any platform or landing which they serve.
3. Employees shall not work on the top two steps of a step ladder and/or above the third rung of an extension ladder. If working in the above is necessary, tie off is required.
4. When ascending or descending ladders, Employees shall have hands free, grip the sides or rungs with both hands, and face the ladder.
5. Ladders used for access shall be placed at a 4 to 1 ratio. For every 4 ft. of vertical height from the structure the ladder is to be placed 1 ft. away.

Example: If the structure is 12 ft. high the ladder would be 3 ft. away from the base of the structure.
6. Job-made ladders shall be constructed so that cleats shall be inset into side rails or filler blocks used. Cleats shall be uniformly spaced, 12 inches, top-to-top.
7. For common sense practice, see Appendix H.

LIGHTING

1. The intensity of lights shall be 3 foot candles in general construction areas and 5 foot-candles or greater on any walkway, ladder, stairway or working level while work is in progress.
2. Temporary lights shall be equipped with guards to prevent accidental contact with the bulb, except when light bulb is deeply recessed and protected by the lamp holder.

MEDICAL SERVICES AND FIRST AID

1. There will be a person trained to render first aid on all projects.
2. First Aid supplies shall be readily available and stored in either or both the tool and office trailer(s).
3. All emergency telephone numbers shall be conspicuously posted near the phone (i.e. 911, ambulance, hospital, doctor, fire and police departments, and paramedics).
4. See Appendix K and O.
5. For a list of WA's medical Treatment Providers, see Appendix O.

EARLY RETURN TO WORK PROGRAM

When an Employee has work related injury or illness the Employee will stay on the project where the injury occurred until he/she has been released to full duty. If the project can not accommodate the injured person, the SBU leader will assign a place for this individual one. The employee is to understand this temporary position is not permanent. Once he/she has been released to full duty, the employee will be returned to their regular duties as they are assigned.

MOTOR VEHICLES

1. Safety Belts shall be properly fastened by employees while driving or riding in Company vehicles. In cases of repeated or flagrant violations of this policy, appropriate disciplinary action shall be required – including revoking the use of Company vehicles.
2. WA vehicle assignees shall not allow passengers (not relating to WA projects) to ride in the Company vehicles without permission from the Company President.
3. Before an employee will be allowed to drive a company vehicle, WA will check his/her driving record to make certain there are no problems which would cause WA to put themselves and others in harm's way.

POWER-ACTUATED TOOLS

1. Only trained Employees shall be allowed to operate power-actuated tools.
2. Certification is to be updated annually.
3. Any defects discovered during use shall be immediately corrected or the tool shall be removed from service until properly repaired.

POWER-OPERATED AND HAND TOOLS

1. No power tool shall be operated without a properly adjusted guard in place.
2. Hand tools shall be used only for the purpose for which they were designed and shall be kept in good repair.
3. Pneumatic power tools shall be secured to the hose by some positive means to prevent the tool from becoming accidentally disconnected.
4. Any tool found not in proper working order, or that develops a defect during use, shall be removed from service until properly repaired.

PROTECTION FOR THE GENERAL PUBLIC

1. Protect the general public from injury or accident by providing warning and protective devices (i.e. signs, flags, lights, barricades), and keeping pedestrian walkways free from obstacles or obstructions.
2. Where vehicular traffic needs to be rerouted, post a flag person or have required signing.
3. Keep spectators (especially children) away from the job-site. Always be courteous but firm in dealing with the public.
4. In the event of an accident involving the public that results in bodily injury or property damage, the Superintendent shall make a detailed written report on the day of the accident and subject it to the Project Manager.
5. The Superintendent, in addition to filing a report, should call the Safety Director/Risk Manager so a follow-up investigation can be made.

RADIOS, TAPE OR CD PLAYERS

Playing of audio equipment is prohibited

SCAFFOLDS

1. Scaffolds shall be capable of supporting four (4) times the maximum intended load and erected on sound, rigid footings, capable of carrying the maximum load without setting or displacement. The standard guardrail is the top-rail minimum 38" and not more than 45" high. The mid-rail is ½ the distance.
2. Fall protection shall be provided when the top-rail is 38" or less.
3. Cross braces may be used as part of the guardrail system when the top-rail meet the following requirements.
 - a. Top-rail when the distance where the braces cross is between 38 and 48 inches.
 - b. Mid-rail when the vertical distance where the braces cross is between 20 and 30 inches.
4. Standard guardrail must be used on all open sides when the height of the scaffold is 10 feet or greater.
5. Scaffold shall be fully planked with a maximum space between planks not greater than 1 inch.
6. Planks that overlap each other must overlap at least 12 inches. If they do not overlap over a support which is attached to the frame, they must be nailed down or secured by some other means.
7. Scaffold planks shall extend at least 6 inches and no more than 12 inches beyond the last support when the span is 8 feet. If the span is 10 feet the distance may extend no more than 18 inches.

8. All walking surfaces must be at least 18 inches wide.
9. A ladder must be attached when the distance between the rungs is greater than 16 ¾ inches or when the width is less than 12 or greater than 16 inches.
10. Maximum distance from the wall or structure following the manufacturers directions or at a ratio of 4:1 then at intervals not to exceed 30 feet horizontally and 26 feet vertically when the scaffolds are greater than 3 feet wide. Scaffolds less than 3 feet wide the intervals are 20 feet vertically and 30 feet horizontally.
11. Cross braces cannot be used as an access.
12. All training must be documented and have available upon request.
13. OSHA requires everyone on your project to be properly trained. This includes employees of subcontractors. The Superintendent should keep a list of all the employees who have been trained before they can work on, erect, or dismantle scaffold.
14. Scaffolding and accessories with defective parts shall be immediately replaced or repaired.
15. Employees using or erecting and dismantling must be trained in proper use and hazards associated with these activities.

TRAINING REQUIREMENTS

DEFINITIONS

Competent Person: One who is capable of identifying existing and predictable hazards in the surrounding or working conditions which are unsanitary, hazardous, or dangerous to employees, and whose authorization you take prompt corrective measures to eliminate them.

Qualified Person: One who, by possession of a recognized degree, certificate, or professional standing, or who by extensive knowledge, training and experience, has successfully demonstrated his/her ability to solve or resolve problems related to the subject matter, the work, or the project.

EMPLOYEE(S) PERFORMING WORK ON SCAFFOLDS

1. Trained by a person qualified in the subject matter to recognize the hazards associated with the type of scaffolding being used and to understand the procedures to control or minimize those hazards. The training will include the following:
 - a. Electrical, fall, and falling object hazards in the work area.
 - b. Hazards associated with disassembling the fall protection and falling object protective systems.
 - c. The proper use of scaffold and the proper handling of materials on the scaffolds.

d. The maximum intended load and load carrying capacities of the scaffolds used.

e. Any other pertinent requirements for working safely on the scaffold.

EMPLOYEE(S) INVOLVED IN

1. Erecting, disassembling, moving operating, repairing, maintaining, or inspecting the scaffold.
2. Training by a competent person to recognize any hazards associated with the work.
 - a. The nature of the scaffold hazard.
 - b. The correct procedures for erecting, disassembling, moving, operating, repairing, inspecting, and maintaining the scaffold.
 - c. The design criteria, maximum intended load and use.

RETRAINING

Retraining is to be done when the following conditions exist:

1. Have reason to believe the employee shows inadequacies in work activity while on the scaffold, erecting and dismantling.
2. Where changes at the work site present hazards in which the employee has not been trained.
3. Changes in the type of scaffold, fall protective systems being used.
4. For additional information see CFR 29, 1926, subpart L.

STORAGE

1. All materials shall be secured to prevent sliding, falling or collapse.
2. Aisles, passageways and exits shall be kept clear.
3. The project Superintendent will approve of an area prior to stocking materials.

AERIAL LIFTS

An aerial lift is any vehicle or device that has:

1. An extendible boom.
2. Aerial ladders.
3. Articulating boom platforms.
4. Vertical towers or any combination.

All of the above require personnel to be tied off while working on or inside these platforms.

PROTECTING PROTRUDING REINFORCED STEEL

1. All protruding reinforced steel will be protected both vertically and horizontally where a person can fall onto or into it.
2. Fall protection will be provided when working above it.
3. See Appendix I for instructions on how to properly protect.

TEMPORARY HEATING

1. Oil-fed heaters shall be shut down and allowed to cool before being moved or refueled to reduce the hazard of flashing vapors in the stack.
2. Heaters shall be placed, so they will not interfere with traffic patterns on the job.
3. Attendants shall be aware of the possibility of carbon monoxide poisoning. Adequate provision for monitoring the air quality shall be made. Report any buildup of harmful vapors to Superintendent and evacuate the area.
4. For further instructions on temporary heating and proper use and care of L.P. gas containers refer to the WA Safety Manual.

THEFT AND VANDALISM

1. Safeguard the job-site from theft and vandalism. WA and its Subcontractors, on open job-sites, are easy prey to vandals. A plan shall be implemented to protect the job-site from:
 - Theft
 - Vandalism
 - Fire by arson or accident
 - Attractive nuisance resulting in injury or death
2. The following list shall be implemented as a minimum for a site security system.
 - Careful scheduling of materials. (Keep excess materials off job-site.)
 - Organized receiving site that confines materials in a specific area.
 - Entire area enclosed by a security fence.
 - Area shall be lighted at night and visible from adjacent streets where possible.
 - Small high value items shall be stored in locked enclosures.
 - A separate parking area for Employees' vehicles will help control the disappearance of tools and materials.

TOILETS

1. One toilet facility shall be provided for every 20 or fewer Employees and be cleaned and serviced weekly.
2. Creating or contributing to unsanitary conditions or failing to use the toilet facilities provided shall be cause for disciplinary action or expulsion from the project.

VENTILATION

1. When working in an enclosed area, the air quality shall be monitored for dangerous levels of gases, dusts or fumes (i.e. carbon monoxide, nitrogen, dioxide or harmful dusts).
2. No quantities of toxic or noxious dusts, fumes, vapors or gases shall exceed the threshold limit values adopted by the American Conference of Governmental Industrial Hygienists.
3. An air quality control test may be performed by the Industrial Commission at no charge.
4. Tests should be conducted periodically by a trained competent person and all test data recorded in the Superintendent's daily log.
5. Refer to the Respiratory Protection Program in the WA Safety Manual.

LASER

The following are some common sense rules for using levels, lasers and transits.

1. Set up in low traffic areas and near barriers if possible.
2. Avoid the path of extension cords, welding cables, and air hoses.
3. On a large job use a permanent location if possible.
4. Set up over dirt or grass if possible.
5. Set laser 12 to 18 inches lower than an optical level. (You are not looking through it).
6. Keep legs on tripod in a wide stance and hobble the legs if set on concrete.
7. Tie fluorescent flagging to tripod legs.
8. Keep level and laser cases closed while using the instrument to keep dirt and moisture out. Protect levels, lasers, transits, and accessories from moisture.
9. Never carry a level, laser, or transit over your shoulder while still attached to the tripod.
10. Set up instruments away from compaction equipment.
11. Put instruments away when not in use and store in a secure location.
12. Where applicable, have warnings signs clearly displayed.
13. Have workers properly trained and OSHA training cards in their possession.
14. Insist on proper training for use of laser.

15. Always carry training verification card.
16. Be sure to post "Caution-Laser Light" placard on the job site.
17. Shut off laser when not in use.
18. Do not look directly into beam.
20. Always use target supplied with system.

GUIDELINES FOR USING NAIL GUNS

All operators must be trained and certified

1. Always wear eye protection.
2. Never use bottled gases.
3. Do not exceed 120 psi.
4. Never carry finger on trigger.
5. Never point nailer toward yourself or anyone else.
6. Always wear ear and head protector.
7. Store nailer properly.
8. Keep work area clean.
9. Never use in presence of flammable liquids or gases.
10. Keep visitors away.
11. Dress properly.
12. Never use on non-relieving coupler on nailer.
13. Check push lever before use.
14. Keep all screws and covers tightly in place.
15. Do not load fasteners with trigger or push lever depressed.
16. Keep hands and feet away from firing head during use.
17. Place nailer properly on workplace.
18. Take care of double fire due to recoil.
19. Do not drive fasteners into thin boards or near corners and edges of workplaces.
20. Never drive fasteners from both sides of a wall at the same time.
21. Check for live wires.
22. Never carry nailer by hose.
23. Do not overreach.

24. Never use nailer which is defective or operates abnormally.
25. Do not disconnect air hose from nailer with finger on trigger.
26. Disconnect air hose from nailer when:
 - a. doing maintenance and inspection;
 - b. cleaning a jam;
 - c. it is not in use;
 - d. leaving work area;
 - e. moving it to another location; and
 - f. handing it to another person.
27. Stay alert.
28. Handle nailer correctly.
29. Never use nailer for applications other than those specified in this manual.
30. Handle nailer carefully.
31. Maintain nailer with care.

CRIME PREVENTION

1. Label all tools and equipment with a marking system to prove ownership. Recommend paint and number system.
2. Take pictures to help identify and recover.
3. Hold tailgate prevention meetings.
4. Invite Police to visit job site.
5. Community relations.
6. Send out Neighborhood Security Watch Bulletins explaining what you're doing and you would appreciate it if they'd help watch the project. AMCC Construction does this and according to them, it has worked
7. Pre-Construction Meetings: Invite Police, Schoolboard, Civic Association, Chamber of Commerce.
8. Establish a reward system to include a 24 hour hot line and posters.
9. Install a six (6) foot fence with 'NO TRESPASSING' signs, crime prevention warnings signs and reward signs.
10. Protective iron on all windows within 14 feet of the ground.
11. Teach employees to challenge strangers.
12. Escort non-employees to personnel.
13. Check delivery vehicles in and out of project.
14. Lock all power sources at the end of the shift.

15. Have a security light and wire into the trailer.
16. Limit key distribution and stamp on all keys "DO NOT DUPLICATE."
17. Jimmy-Proof Type of Locks.
18. Use butt-end hinges or have hinges on the inside.
19. Weld all hasps, use non-retractable screws or use twist off head screws.
20. Conceal hinge butts.
21. Mount hinges and hasps to prevent removal.
22. Alarm doors.
23. Guard dogs.
24. Secure gang boxes so they cannot be removed.
25. Inspect equipment at the end of each day.
26. Have a security check list.
27. Report all theft as soon as possible to local police.
28. Protect all areas that are 1 square foot or more.
29. Explain National Crime Information Centers.

WELDING, CUTTING, AND HEATING

1. Proper precautions for fire prevention shall be taken in areas where welding or other "hot work" is being done (i.e. removing fire hazard from the vicinity and providing a fire watch with an extinguisher on hand during remodel work).
2. Always wear approved tinted eye protection when welding or cutting in areas where welding is being done. See Appendix A.
3. Refer to "Hot Work Procedures" in the "WA Safety" manual.

HAZARDOUS WASTE DISPOSAL

This procedure is designed to prevent Wilkinson Electric/Ace Mechanical from becoming a generator of hazardous materials and to stay in compliance with the EPA. If there are any questions concerning this policy, call WA Safety and Environmental Director.

Projects which have hazardous substances such as: form oil, curing compound diesel, gasoline, solvents, corrosive reactive waste, acids, alkalines, and any other hazardous substance must do the following:

1. Do not return the hazardous waste to the WA warehouse. WA will not allow hazardous substances or hazardous wastes to be stored in the storage yards.
2. If the unused hazardous substances are not contaminated and can be used, take them to your next project or find a job site that has need for the hazardous material.

3. If the hazardous substance is not contaminated and you are unable to find a project that can use the substance, call the supplier where you purchased it and they will come and get it.
4. If the hazardous substance is contaminated, call purchasing or the safety director for direction in disposing the material.

DISPOSAL OF EMPTY CONTAINERS

1. Call the supplier and they will come and get the containers as long as they are not contaminated.
2. If you choose not to have the supplier come and get the containers, do the following:
 - a. Triple rinse the container with water.
 - b. Burn off the excess residue.
 - c. Remove the labels and other identifiable information.
 - d. Cut both ends off with a saw – not a torch
 - e. Smash the container and dispose of it in the dumpster.

STORAGE

1. Place a berm around the area which is large enough to hold the contents being stored.
2. Line the bermed area with a chemical resistant material.
3. Place a 20inch pipe with a cap on the outside end through the berm to drain off excess water.
4. Place a “No Smoking” sign within 50 feet of the area and have a 20 pound ABC fire extinguisher no closer than 25 feet and no further than 75 feet from the area.

JOB FOREMAN

THE PHILOSOPHY OF PRODUCTION AND SAFETY MUST BE INSEPARABLE

1. Know and enforce all safety rules and regulations (i.e. WA Safety and Drug Policies and Company Rules, the Occupational Safety and Health Construction Standards) and all other state and local requirements.
2. Instruct new and existing Employees in safe working practices.
3. Ensure all work is performed in a safe manner and that no unsafe condition or equipment exists. The Superintendent is responsible for the safety of all men on his crew and therefore, personally liable by law for any accident or injury that occurs because of his neglect to safety. **(Contributory Neglect)**.
4. See that all personnel protective equipment is available and used.
5. Correct, log and report all unsafe conditions, practices or near misses to the office. This information will be discussed in the Project Safety Meeting.

6. Be responsible for holding a weekly Safety meeting, teaching or demonstrating safe practices. Discuss unsafe conditions found and the corrections made, near misses, safety training lessons, and any injuries and how to avoid any recurrence. Fill out the Safety meeting Report, logging attendance, and turn it in to the office.
7. Secure prompt medical attention for any injured Employee.

“TREAT THE PATIENT AND THEN TREAT THE PAPERWORK”

8. Call WA Emergency Medical Technician.
9. Report any injury resulting in the loss of consciousness, loss of time or the inability to perform the duties of the injurer’s regular job to the office. Fill out the Notice of Accident and send it to the office. The Employer’s Report of injury form shall be completed by the Secretary. Each accident that is defined as recordable must be reported immediately.
10. Notify the Drug Testing Agency and make arrangements for the testing to be performed.
11. Any Employee injured in an accident or any Employee causing an accident must be drug/alcohol tested the same day of the incident.
12. See Appendix L for Company Authorized Doctors.

EMPLOYEE RESPONSIBILITY

THE BEST SAFETY EQUIPMENT IN THE WORLD WILL NEVER REPLACE A CAREFUL WORKMAN

1. The direct responsibility of all Employees is that no job can be considered completely finished unless the worker has followed every precaution and safety rule to protect himself and his fellow workers.

“THE PHILOSOPHY OF PRODUCTION AND SAFETY MUST BE INSEPARABLE”

2. Read and acknowledge understanding of WA’s Safety and Drug Policy and Company rules by signing the tear out slip found in the front of the WA Safety Handbook and turn it into the office. If any questions arise concerning WA Company Policy, ask your Superintendent or contact the office. The tear out slip will go into your permanent personal file.
3. Observe all safety rules and regulations (i.e. WA’s Safety and Drug Policy and Company Rules, the Occupational Safety and Health Construction Standards) and all other state and local safety requirements.
4. Attend a weekly Tool Box Safety Meeting conducted by your foreman and the Project Safety Meeting conducted by the Superintendent or his Safety Technician.
5. Use and maintain all personal safety devices provided.

6. Maintain and properly use all tools under your control.
7. Use proper lifting techniques to avoid strains and sprains. See Appendix E.
8. Correct unsafe conditions and practices and report them along with all near misses to your Superintendent for discussion in the Weekly Safety Meeting.
9. No employee is expected to sacrifice anything for safety.
10. Safety is to be an intricate part of your quality control, cost reduction and job efficiency.

REPORTING A WORK-RELATED INJURY/ILLNESS

1. If you feel you have an injury/illness that is work-related, report it to your Superintendent or General Foreman immediately.
2. If it is determined you need medical treatment, you will be taken to a WA Workers Compensation medical provider.
3. If the injury or illness is work-related, DO NOT GO to a medical provider other than one required by the WA Workers Compensation carrier.
4. If you do go to a provider other than one required by the WA Workers Compensation carrier for a work-related injury or illness, you will be responsible for payment of treatment received by that provider.
5. The WA Pocket Safety Handbook lists the WA Workers Compensation carriers you are required to use.
6. The Superintendent of Foreman will send a report to the Risk Control Department within 24 hours.

DRUGS AND ALCOHOL

The Company prohibits the use, possession, or distribution on its premises, in its work places, or during working time, of any of the following: alcoholic beverages, intoxicants, narcotics, illegal or unauthorized drugs or drug paraphernalia. Company employees shall not report for work under the influence of any drug, alcoholic beverage, narcotic, or other controlled substance. This includes legally prescribed drugs and medicines which will, in any way, adversely affect their working ability, alertness, and/or coordination or which will adversely affect the safety of others on the job.

Consistent with the intent of this policy, the Company reserves the right to drug test potential employees as a condition of employment and thereafter and may require randomly selected employees to take drug screens to ensure continuing compliance with the Company's drug policy. The Company also reserves the right to drug screen based on reasonable suspicion.

Employee involved in an accident resulting in an industrial injury/illness or an incident which could have resulted in serious injury, death, or equipment damage, are immediately subject to a mandatory drug screen. Refusal to submit to or failure to pass the drug screen will be grounds for immediate termination or refusal to hire. Additionally, the Company reserves the right to search any Company property, facilities or equipment, employee vehicles or other personal

property if located on Company premises or job work sites. The Company may seize any controlled substances and report the same to law enforcement personnel. Refusal to submit to such search will result in immediate removal from service and possible termination.

Any employee who violates this policy, including failing to pass, refusing to submit to drug screen, or tampering with or adulterating a sample is subject to disciplinary action, including refusal to hire, immediate termination, immediate removal from a work site, and future prohibition from the premises.

Legally prescribed drugs may be permitted on Company premises or work locations, provided these drugs are contained in the original prescription container and are prescribed by an authorized medical doctor for the current use of the person possessing the drug. It is the responsibility of each employee who is taking prescribed medication to inform his physician of his job duties and to inform his/her Supervisor of any such medication which would restrict him/her in performing his/her duties in a safe and efficient manner.

All information, interview, reports, statements, memorandums, or test results received by the Company and any of its supervisors will be kept as confidential as possible. Individuals may request a retest of the sample.

Former Employees who were terminated because of a violation of this policy may reapply for employment with the Company only after successfully completing a drug/alcohol rehabilitation program at the individual's own expense and successfully passing a drug screen.

THINGS TO REMEMBER ABOUT DRUGS

1. The abuse of alcohol and drugs requires an act of will on the part of the user.
2. The Company believes that an individual is responsible for his own actions. Employees are to be held accountable at all times for satisfactory job performance and acceptable work behaviors.
3. WA reserves the right, in its discretion, to report use, possession or distribution of any illegal substance, or drug named in the Company Drug Policy to law enforcement officials and turn over to the custody of law enforcement officials any such substance or person(s) involved with said substance.
4. When it is determined that an Employee is suffering from an alcohol or drug abuse problem and Management decides to continue the employment of the Employee, the Management's decision to continue employment requires that:
 - a. The Employee recognizes and admits that he/she has an alcohol or drug problem.
 - b. The Employee accepts and understands that if he/she does not correct his/her problem and maintain satisfactory work performance, he/she will be subject to discharge.
 - c. The Employee shows proof that he has successfully completed a Drug Rehabilitation Program.

d. Employees of Subcontractors who have an industrial injury or illness which has the potential of being a lost time accident/illness, or will be lost time accident/illness, or damages a piece of equipment such as tipping over a forklift, etc., will be drug tested. If the Employee refuses to be tested or fails the drug test, he/she will be removed from the project.

5. Guidelines for Reasonable Suspicion of Drug Use. If you suspect that an Employee on your project is using drugs or alcohol, and you wish to test them, you should:

- a. Document the events which led up to the suspicion of the Employee using drugs or alcohol, date and time of occurrences, witnesses, and behavior, actions or physical symptoms of the Employee.
- b. Make the Employee aware of why he/she is to be tested, because of reasonable suspicion, and the reason behind your decision.
- c. Screen the Employee as soon as possible. After the test, the employee should be put in a position on the job site where he/she cannot harm themselves or others until the test results are received.
- d. Make sure the Employee is screened for the correct substance(s): urinalysis for suspicion of drugs, a blood alcohol test for the suspicion of alcohol. Give both screens if you suspect drugs and alcohol.
- e. Receive the test results from the office before any action is taken.
- f. For Drug Information Guide, see Appendix N.

WORKPLACE VIOLENCE

The safety and security of our employees, customers, subcontractors, and the general public are of vital importance. Therefore, the Company has a “zero tolerance for violence” policy. Employees displaying or threatening any violence in the workplace are subject to immediate termination. No talk of violence or joking about violence will be tolerated. Further, the Company does not allow employees to bring guns or other weapons to its work sites.

We define “violence” to include physically harming another, shoving, pushing, harassment, intimidation, coercion, brandishing weapons, and threats or talk of violence.

It is everyone’s business to prevent violence in the workplace. Often, employees are in a better position than Management to know what is happening with those around them. Employees can help by reporting anything in the workplace that could indicate a co-worker is in trouble to a supervisor or to Human Resources.

If a violent incident occurs on Company property, employees are not expected to endanger their own lives or health to help others but will not be penalized for engaging in such action if such action results in violating other workplace policies and/or procedures. If a violent incident occurs, employees should immediately inform a supervisor on site. The police should be called, if necessary. **See also Standards of Conduct and Drugs and Alcohol.**

SOLICITATION AND DISTRIBUTION OF LITERATURE

To avoid disruption of Company operations and to ensure safe working conditions, the following rules apply to solicitations and distribution of non-Company literature on Company property and at Company work sites:

- Employees may not solicit other employees for membership, contributions, funds, or other purposes during employee’s working time, or at any other time if the solicitation interferes with other employees who are scheduled to work.
- Employees may not distribute non-Company literature during working time for any purpose.
- Employees may not distribute non-Company literature (other than Company information) at any time for any purpose in working areas.
- Only employees and suppliers and purveyors of goods and services, who are pre-authorized by the Company, are allowed on Company property and work sites.

Persons who are not employed by the Company may not solicit or distribute non-Company literature on Company property at any time for any purpose.

Working time includes the working time of both the employee doing soliciting and /or distributing and the employee to whom the soliciting and/or distributing is directed. Working time does not include break periods or meal periods.

Management may authorize the posting of literature to solicit funds for recognized and established charities which benefit the general community.

Employees who violate this policy will be subject to discipline, up to and including termination.

GUIDELINES FOR DISPLAYING FLAGS ON PROJECTS


On all job sites with office trailers, WA will display the American and the WA Company flags. The Superintendent is responsible for proper care and display of these flags.

The flag should be displayed everyday. Flags will be illuminated by lights mounted on trailers. Please maintain lights in order to display flag at all times. Without lighting, please display during the day only with the flag being raised at the beginning of the workday and lowered at the end of the work shift.

The flag should be raised and lowered by hand and never raised when furled. The flag should never be allowed to touch anything beneath it, such as the ground or floor. When flown at half-staff, the flag should be first hoisted to the peak, then immediately lowered to the half-staff position. It should be raised to the peak again for a moment before it is lowered for the day. When the flag is a half-staff, remove the WA Company flag because of the clearance between the flag and the trailer at half-staff. No other flag may be flown above the United States flag.

APPENDIX A

EYE AND FACE PROTECTION

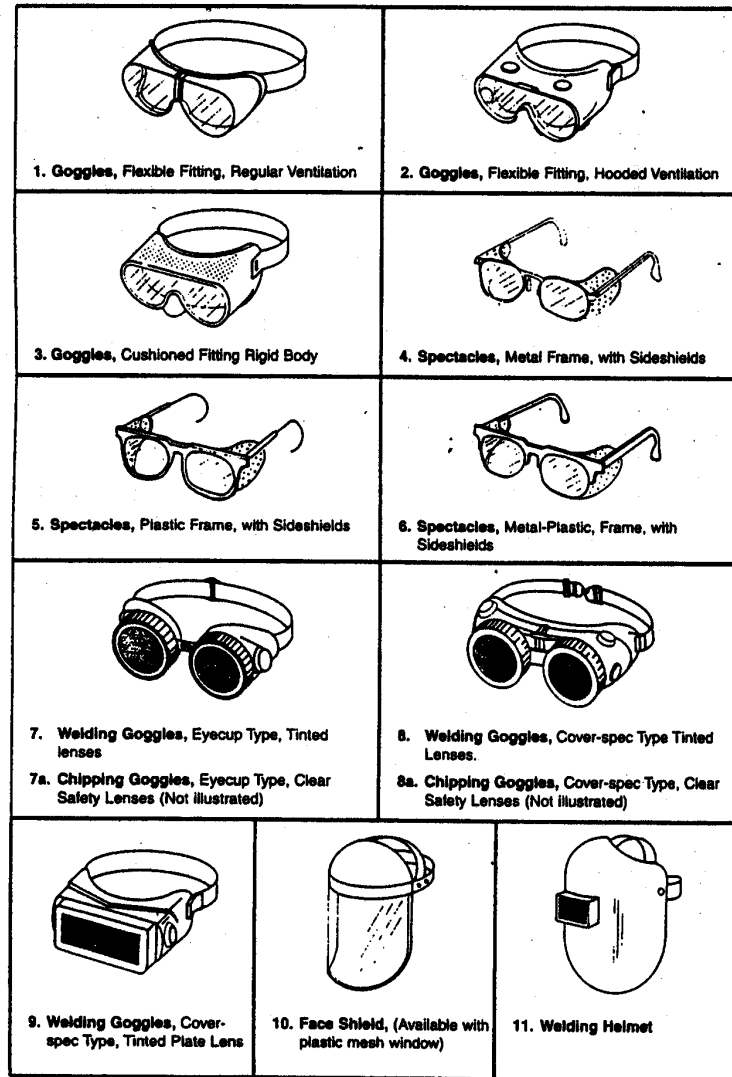

SAFETY GLASSES AND GOGGLE APPLICATIONS

Operations	Hazards	Recommended Protectors
Acetylene – Burning Acetylene – Cutting Acetylene - Welding	Sparks, Harmful Rays, Molten Metal, Flying Particles	7, 8, 9
Chemical Handling	Splash, Acid Burns, Fumes	2, 10 (for severe exposure add 10 over 2)
Chipping	Flying Particles	1, 3, 4, 5, 6, 7A, 8A
Electric Welding(Arc)	Sparks, Intense Rays, Molten Metal	9, 11 (11 in combination with 4, 5, 6, in tinted lenses advisable)
Furnace Operation	Glare, Heat, Molten Metal	7, 8, 9 (for severe exposure and 10)
Grinding - Light	Flying Particles	1, 3, 4, 5, 6, 10
Grinding – Heavy	Flying Particles	1, 3, 7A, 8A, (for severe exposure add 10)
Laboratory Machining	Chemical Splash, Glass Breakage, Flying Particles	2 (10 when in combination with 4, 5, 6) 1, 3, 4, 5, 6, 10
Molten Metals	Heat, Glare, Sparks, Splash	7, 8 (10 in combination with 4, 5, 6, in tinted lenses)
Spot Welding	Flying Particles, Sparks	1, 3, 4, 5, 6, 10

APPENDIX B

RIGGINGS

CLIPS AND SPACING FOR SAFE APPLICATION

Rope Diameter Inch	Approximate Weight lb.	Minimum Number Clips for each Rope End	Spacing of Drop Forged Clips Inches
3/16	.10	3	1-1/8
1/4	.19	3	1-1/2
5/16	.29	3	1-7/8
3/8	.47	3	2-1/4
7/16	.70	3	2-5/8
1/2	.78	3	3
5/8	1.06	3	3-3/4
3/4	1.59	4	4-1/2
7/8	2.40	4	5-1/4
1	2.72	5	6
1-1/8	3.20	6	6-3/4
1-1/4	4.50	6	7-1/2
1-3/8	4.60	7	8-1/4
1-1/2	5.80	7	9
1-5/8	7.20	7	9-3/4
1-3/4	9.50	9	10-1/2
2	12.50	9	12
2-1/4	15.50	9	13-1/2
2-1/2	18.00	9	15

**THE RIGHT WAY
TO CLIP WIRE ROPE**



**THE WRONG WAY
TO CLIP WIRE ROPE**



**THE RIGHT WAY
TO JOIN WIRE ROPE**



**THE WRONG WAY TO
JOIN WIRE ROPE**



1. CORRECT METHOD — U- Bolts of clips on short end of rope.
(No distortion on live end of rope.)



2. WRONG METHOD — U-Bolts on live end of rope.
(This will cause mashed spots on live end of rope.)



3. WRONG METHOD — Staggard clips, two correct and one wrong.

(This will cause mashed spot in live end of rope due to wrong position of center clip.)

**4. After rope is in service, and is under tension, tighten clips
to take up decrease in rope diameter.**

GOOD AND BAD RIGGING PRACTICES

Use of Chokers



Bad
Because of cutting action of eye splice on running line



Bad
Bolt on running line can work loose



Good
No cutting action on running lines



Eye Splices




Bad Practice
Wire rope knot with clip. Efficiency 50% or less



Bad Practice
Thimble should be used to increase strength of eye and reduce wear on rope




Good Practice
Note use of thimble in eye splice




Good Practice
Use of thimble in eye splice

Hook Slings

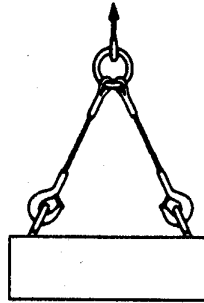


Bad Practice
Hook openings should be turned out

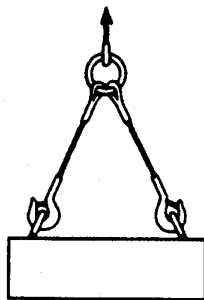


Good Practice
Hooks are turned out

GOOD AND BAD RIGGING PRACTICES

Double slings shall be used when hoisting 2 or more pieces of material over 12 feet long

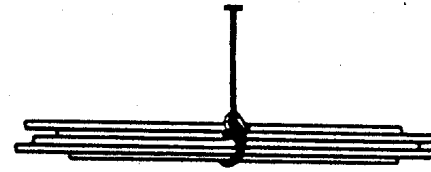


Wrong
Load over 12' long

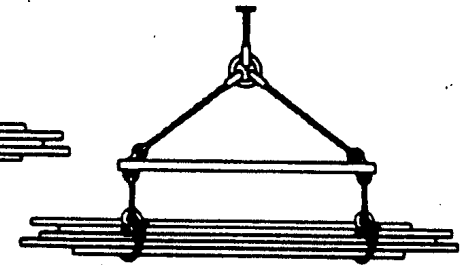


Right
Load over 12' long

Eye Bolts

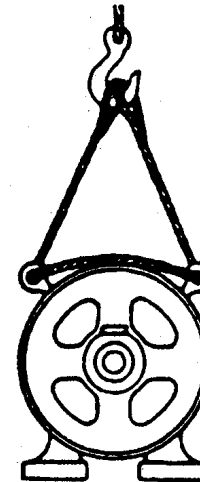

Bad Practice
Lifting on eye bolts from an angle reduces safe loads as much as 90%

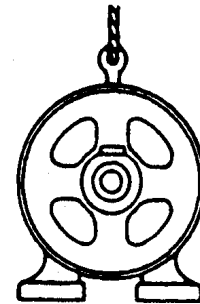

Good Practice
Vertical lift on eyebolt is good practice

Hoisting Structural Steel



Bad Practice
Can bend flanges and cut rope




Good Practice
Use space blocks and pad corner


Suspending Needle Beams or Scaffolds




Bad Practice
Steel can cut rope

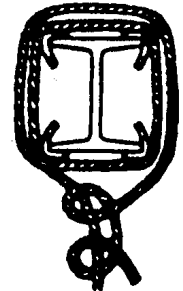


Good Practice
Sharp corners padded

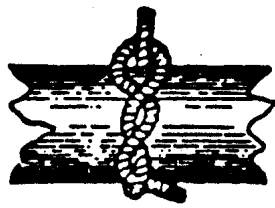

Timber Hitch

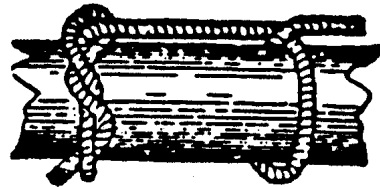

Timber Hitch and Half Hitch

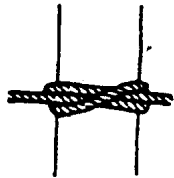

Clove Hitch




Square or Reef Knot




Sheepshank




Stopper Hitch

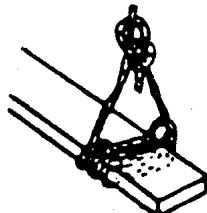

Scaffold Hitch

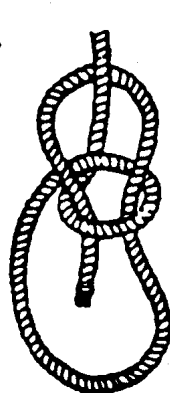


Bowline

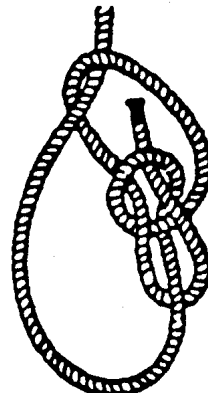

Running Bowline



Becket Knot

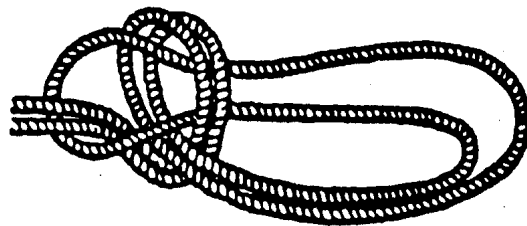

Bowline on a Bight

RATED CAPACITIES OF SINGLE AND MULTIPLE LEG SLINGS

Rope Diam. Inches	Single Leg			Two Leg			Three Leg			Four Leg		
	Straight	Choker	Vertical	Max. Angle Any leg			Max. Angle Any Leg			Max. Angle Any		
	Vertical	Hitch	Basket	to Vertical			to Vertical			Leg to Vertical		
	Pull		Hitch	15°	30°	45°	15°	30°	45°	15°	30°	45°
1/4	0.56	0.42	1	1.1	0.97	0.79	1.6	1.4	1.2	2.1	1.9	1.6
3/8	1.2	0.93	2.2	2.4	2.1	1.8	3.6	3.2	2.6	4.8	4.3	3.5
1/2	2.2	1.6	3.9	4.2	3.8	3.1	6.3	5.7	4.6	8.4	7.6	6.2
3/4	4.9	3.6	8.8	9.4	8.4	6.9	14	13	10	19	17	14
5/8	3.4	2.5	6.1	6.6	5.9	4.8	9.8	8.8	7.2	13	12	9.6
7/8	6.6	4.9	12	13	11	9.3	19	17	14	25	23	18
1	8.5	6.4	15	16	15	12	25	22	18	33	29	24
1 1/8	10	7.8	19	20	18	15	30	27	22	40	36	29
1 1/4	12	9.2	23	24	21	17	35	32	26	47	42	34
1 3/8	15	11	27	28	25	21	43	38	31	57	51	42
1 1/2	17	13	32	34	30	25	51	45	37	67	60	49

RATED CAPACITIES 6X19 WIRE ROPE

Diameter Inches	Circumference approx. Inches	Weight per ft. approx. lb.		Breaking Strength in tons of 2,000 lb.		
		Fiber	IWRC	XIPS		IPS
				IWRC	Fiber	
1/4	3/4	.015	.116	3.40	2.74	2.94
5/16	1	.164	.180	5.27	4.26	4.58
3/8	1-1/8	.236	.26	7.55	6.10	6.56
7/16	1-3/8	.32	.35	10.2	8.27	8.89
1/2	1-5/8	.42	.46	13.3	10.7	11.5
9/16	1-3/4	.53	.59	16.8	13.5	14.5
5/8	2	.66	.72	20.6	16.7	17.9
3/4	2-3/8	.95	1.04	29.4	23.8	25.6
7/8	2-3/4	1.29	1.42	39.8	32.2	34.6
1	3-1/8	1.69	1.85	51.7	41.8	44.9
1-1/8	3-1/2	2.13	2.34	65.0	52.6	56.5
1-1/4	3-7/8	2.63	2.89	79.9	64.6	69.4
1-3/8	4-3/8	3.18	3.50	96.0	77.7	83.5
1-1/2	4-3/4	3.78	4.16	114	92.0	98.9
1-5/8	5-1/8	4.44	4.88	132	107	115
1-3/4	5-1/2	5.15	5.67	153	124	133
1-7/8	5-7/8	5.91	6.50	174	141	152
2	6-1/4	6.72	7.39	198	160	172

SHACKLES SCREW PIN ANCHOR TYPE				FORGED EYE BOLTS SHOULDER NUT			
Normal Shackles Size (Inches)	Working Load Limit (Pounds)	Normal Shackle Size (Inches)	Working Load Limit (Pounds)	Shank Size (Inches)	90° to Horizontal	60° to Horizontal	45° to Horizontal
3/16	660	1	17,000	¼	500	175	125
¼	1,000	1-1/8	19,000	5/16	800	280	200
5/16	1,500	1-1/4	24,000	3/8	1,200	420	300
3/8	2,000	1-3/8	27,000	½	2,200	770	550
7/16	3,000	1-1/2	34,000	5/8	3,500	1,225	875
½	4,000	1-3/4	50,000	¾	5,200	1,820	1,300
5/8	6,500	2	70,000	7/8	7,200	2,250	1,800
¾	9,500	2-1/4	80,000	1	10,000	3,500	2,500
7/8	13,000	2-1/2	110,000	1-1/4	15,200	5,320	3,800
				1-1/2	21,400	7,490	5,350

WIRE ROPE SLINGS 6 X 19 OR 6 X 37 IWRC IPS

Rope Diameter (Inches)	Vertical (1)	Choker (1)	Vertical Basket (2)	60° to Horizontal	45° to Horizontal	30° to Horizontal	Rope Diameter (Inches)
¼	1,120	840	2,200	1,940	1,580	1,120	¼
3/8	2,400	1,860	5,000	4,200	3,600	2,400	3/8
½	4,400	3,200	8,800	7,600	6,200	4,400	½
5/8	6,800	5,000	13,600	11,800	9,600	6,800	5/8
¾	9,800	7,200	19,400	16,800	13,800	9,800	¾
7/8	13,200	9,800	26,000	22,000	18,600	13,200	7/8
1	17,000	12,800	34,000	30,000	24,000	17,000	1
1-1/8	20,000	15,600	42,000	36,600	30,000	20,000	1-1/8
1-1/4	24,000	18,400	48,000	42,000	34,000	24,000	1-1/4
1-3/8	30,000	22,000	58,000	50,000	42,000	30,000	1-3/8
1-1/2	34,000	26,000	70,000	60,000	50,000	34,000	1-1/2
1-5/8	40,000	30,000	82,000	70,000	58,000	40,000	1-5/8
1-3/4	48,000	36,000	94,000	82,000	66,000	48,000	1-3/4
2	60,000	46,000	122,000	106,000	86,000	60,000	2

ALLOY CHAIN SLINGS WORKING LOAD LIMITS *

Size Of Chain		Single Chain Lbs. at 90°	Double Chain Sling/lbs. Type D			Triple and Quad Chain Slings/lbs. Type T and Type Q		
Inches	mm							
9/32	7	3,500	6,050	4,950	3,500	9,100	7,400	5,250
3/8	10	7,100	12,300	10,000	7,100	18,500	15,000	10,600
½	13	12,000	20,800	17,000	12,000	31,200	25,000	18,000
5/8	16	18,100	31,300	25,600	18,100	47,000	38,400	27,200
¾	20	28,300	49,000	40,000	28,300	73,500	60,000	42,500
7/8	22	34,300	59,400	48,500	34,300	89,100	72,800	51,500
1	26	38,750t	67,000	54,800	38,760	100,600	82,200	58,200
1-1/4	32	57,500t	99,600	81,300	57,500	149,400	122,000	86,300

*Important: Working Load Limit should not be exceeded. Ratio 4 to 1
t Values shown for these sizes are Grade 63 embossed "A" only.

SYNTHETIC WEB SLINGS

HEAVY DUTY 8000 LBS. WEBBING – SINGLE PLY TRIANGLE

Sling body width (inches)	Vertical	Choker	Vertical Basket	60° Basket	45° Basket	30° Basket
1	1,600	1,200	3,200	2,720	2,240	1,600
2	3,200	2,400	6,400	5,440	4,480	3,200
3	4,800	3,600	9,600	8,160	6,720	4,800
4	6,400	4,800	12,800	10,880	8,960	6,400
5	8,000	6,000	16,000	13,600	11,200	8,000
6	9,600	7,200	19,200	16,320	13,440	9,600

Notes:

- All angles shown are measured from the horizontal.
- Capacities for intermediate widths not shown may be obtained by interpolation.

CONCRETE REINFORCING STEEL

WEIGHT & DIMENSIONS ASTM STANDARD REINFORCING BARS			
Bar Size Designation	Weight Pounds Per Ft	Normal Dimensions	
		Diameter Inches	Cross Sectional Area Sq. Inches
#3	0.376	0.375	0.11
#4	0.688	0.500	0.20
#5	1.043	0.625	0.31
#6	1.502	0.750	0.44
#7	2.044	0.875	0.60
#8	2.670	1.000	0.79
#9	3.400	1.128	1.00
#10	4.303	1.270	1.27
#11	5.313	1.410	1.56
#14	7.650	1.693	2.25
#18	13.600	2.257	4.00

WEIGHT OF METALS PER SQUARE FOOT

Thickness In Inches	Weights, Pound per Square Foot			
	Wrought Iron	Cast Iron	Steel	Copper
1/16	2.50	2.34	2.55	2.89
1/8	5.00	4.69	5.10	5.79
3/16	7.50	7.03	7.65	8.68
¼	10.00	9.38	10.25	11.60
5/16	12.50	11.70	12.80	14.50
3/8	15.00	14.10	15.30	17.40
7/16	17.50	16.40	17.90	20.30
½	20.00	18.70	20.40	23.20
9/16	22.50	21.10	23.00	26.00
5/8	25.00	23.50	25.50	28.90
11/16	27.50	25.80	28.10	31.80
¾	30.00	28.10	30.60	34.70
13/16	32.50	30.50	33.20	37.60
7/8	35.00	32.80	35.70	40.50
15/16	37.50	35.20	38.30	43.40
1	40.00	37.50	40.80	46.30

COMMON METRIC EQUIVALENTS*

1 inch.....	25.400 millimeters
1 foot	0.300 meters
1 yard.....	0.910 meters
1 mile.....	1.610 kilometers
1 square inch	6.450 centimeters
1 square foot	0.090 square meters
1 square yard	0.860 square meters
1 cubic inch.....	16.390 cubic centimeters
1 cubic foot	0.030 cubic meters
1 cubic yard.....	0.760 cubic meters
1 quart	0.950 liters
1 gallon	0.004 cubic meters
1 ounce.....	28.350 grams
1 pound	0.450 kilograms
1 horsepower	0.750 kilowatts
1 millimeter	0.040 inches
1 meter	3.280 feet
1 meter	1.090 yards
1 kilometer.....	0.620 miles
1 square centimeter	0.160 square inches
1 square meter.....	10.760 square feet
1 square meter.....	1.200 square yards
1 cubic centimeter	0.060 cubic inches
1 cubic meter	35.310 cubic feet
1 cubic meter	1.310 cubic yards
1 cubic meter	264.200 gallons
1 liter.....	1.060 quarts
1 liter.....	61.025 cubic inches
1 gram.....	0.040 ounces
1 kilogram	2.200 pounds
1kilowatt.....	1.340 horsepower

*closest approximation

DECIMAL EQUIVALENTS OF AN INCH

1/64	.015625	33/64	.515625
1/32	.03125	17/32	.53125
3/64	.046875	35/64	.546875
1/16	.0625	9/16	.5625
5/64	.078125	37/64	.578125
3/32	.09375	19/32	.59375
7/64	.109375	39/64	.609375
1/8	.125	5/8	.625
9/64	.140625	41/64	.640625
5/32	.15625	21/32	.65625
11/64	.171875	43/64	.671875
3/16	.1875	11/16	.6875
13/64	.203125	45/64	.703125
7/32	.21875	23/32	.71875
15/64	.234375	47/64	.734375
1/4	.25	3/4	.75
17/64	.265625	46/64	.765625
9/32	.28125	25/32	.78125
19/64	.296875	51/64	.796875
5/16	.3125	13/16	.8125
21/64	.328125	53/64	.828125
11/32	.34375	47/32	.84375
23/64	.359375	55/64	.859375
3/8	.375	7/8	.875
25/64	.390625	57/64	.890625
13/32	.40325	29/32	.90625
27/64	.421875	59/64	.921875
7/16	.4375	15/16	.9375
29/64	.45125	61/64	.953125
15/32	.46875	31/32	.96875
31/64	.484375	63/64	.984375
1/2	.5		

WEIGHTS AND MEASURES

HANDY THINGS TO KNOW

To Find:

- The circumference of a circle, multiply the diameter by 3.1416.
- The diameter of a circle, multiply the circumference by .31831.
- The area of a circle, multiply the square of the diameter by .7854
- The area of a triangle, multiply the base by $\frac{1}{2}$ the perpendicular height.
- The volume of a sphere, multiply the cube of the diameter by .5236.

A gallon of water weighs 8-1/2 pound and contains 231 cubic inches.

A cubic foot of water contains 7-1/2 gallons,
1,728 cubic inches and weighs 62-1/2 pounds.

One atmosphere = 33.899 feet of water at 39...F.

One atmosphere = 760 mm of mercury.

One atmosphere = 14.7 pounds per square inch.

Capacity of Cylindrical Tanks – U.S. Gallons and Barrels (Petroleum) per foot of length or height.

Capacity per foot, U.S. gallon =

$$\frac{\pi D^2 \times 7.481}{4}$$

In board measure all boards are assumed to be 1 inch thick. Area of a linear foot multiplied by length in feet will give the surface contents in square feet.

RULES OF THUMB

The following are **not** suggested as substitutes for accurate tables and reference material, but are sometimes useful in making a final safety check.

Nails

Safe load lateral resistance in pounds equal (8) times the pennyweight.

1-6d nail = 8 x 6, or 48 pounds

1-10d nail = 8 x 10, or 80 pounds

Manila Rope

Safe load in tons equal diameter in inches squared. Not accurate in sizes larger than one inch (1").

1" rope = 1 x 1, or 1 ton safe load

$\frac{1}{2}$ " rope = $\frac{1}{2} \times \frac{1}{2}$, or $\frac{1}{4}$ ton safe load

For sisal rope, decrease safe load by one-third

Plow-steel Cable

Safe load in tons is eight (8) times the diameter in inches squared.

$\frac{1}{2}$ " cable = $\frac{1}{2} \times \frac{1}{2} = \frac{1}{4} \times 8 = 2$ tons

Open Eye Hook

Safe load in tons is diameter of eye in inches squared

2" hook, $2 \times 2 = 4$ tons

Shackle

Safe load in tons is diameter of pin in one-fourth inches ($\frac{1}{4}$ ") squared and divided by three (3).

$\frac{1}{2}$ " diameter = 2 quarters

$\frac{2 \times 2}{3} = 1\text{-}1/3$ tons or 2,667 pounds

Chains

Safe load in tons is six (6) times the square of the diameter of chain stock.










$\frac{1}{2}$ " diameter chain stock

$\frac{1}{2} \times \frac{1}{2} \times 6 = 1\text{-}1/2$ tons or 3,000 pounds









APPENDIX C

HAND SIGNALS

RECOMMENDED HAND SIGNALS FOR CONTROLLING CRANE OPERATIONS

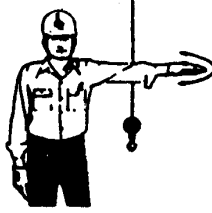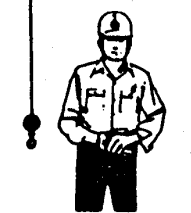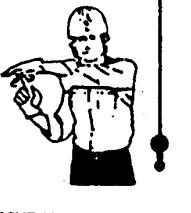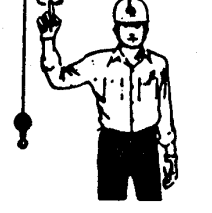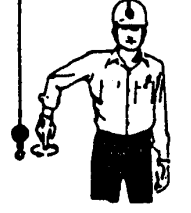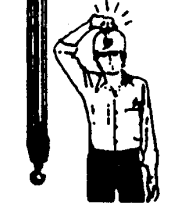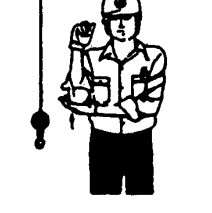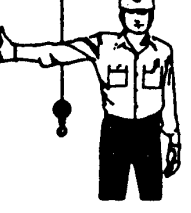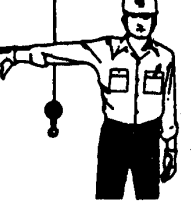
 STOP: Arm extended, palm down, move hand right and left.	 DOG EVERYTHING: Clasp hands in front of body.	 MOVE SLOWLY: Use one hand to give any motion signal and place other hand motionless in front of hand giving the motion signal (Hoist slowly shown as example)
 HOIST: With forearm vertical, forefinger pointing up, move hand in small horizontal circles.	 LOWER: With arm extended downward, forefinger pointing down, move hand in small horizontal circles.	 USE MAIN HOIST: Tap fist on head, then use regular signals.
 USE WHIPLINE: (Auxiliary hoist) Tap elbow with one hand, then use regular signals.	 RAISE BOOM: Arm extended, fingers closed, thumb pointing upward.	 LOWER BOOM: Arm extended, fingers closed, thumb pointing downward.

RECOMMENDED HAND SIGNALS FOR CONTROLLING CRANE OPERATIONS (continued)

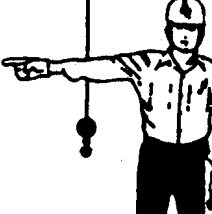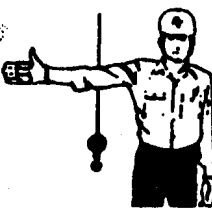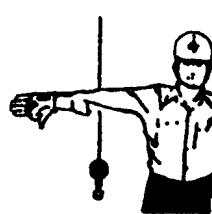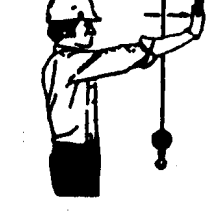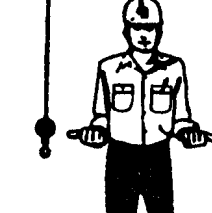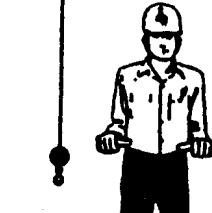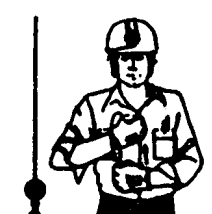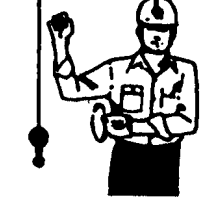 SWING: Arm extended, point with finger in direction of swing of boom.	 RAISE THE BOOM AND LOWER THE LOAD: With arm extended thumb pointing up, flex fingers in and out as long as load movement is desired.	 LOWER THE BOOM AND RAISE THE LOAD: With arm extended, thumb pointing down, flex fingers in and out as long as load movement is desired.
 TRAVEL: (Rail Mount or trolley) arm extended forward, hand open and slightly raised, making pushing motion in direction of travel.	 EXTEND BOOM: (Telescoping booms) Both fists in front of body with thumbs pointing outward.	 RETRACT BOOM: (Telescoping booms) Both fists in front of body with thumbs pointing toward each other.
 TRAVEL: Arm extended forward, hand open and slightly raised, making pushing motion in direction of travel.	 TRAVEL: (One track. Lock the track on side indicated by raised fist. Travel opposite track in direction indicated by circular motion of other fist, rotated vertically in front of body. (For crawler cranes only)	

APPENDIX D

CONCRETE PUMP HAND SIGNALS

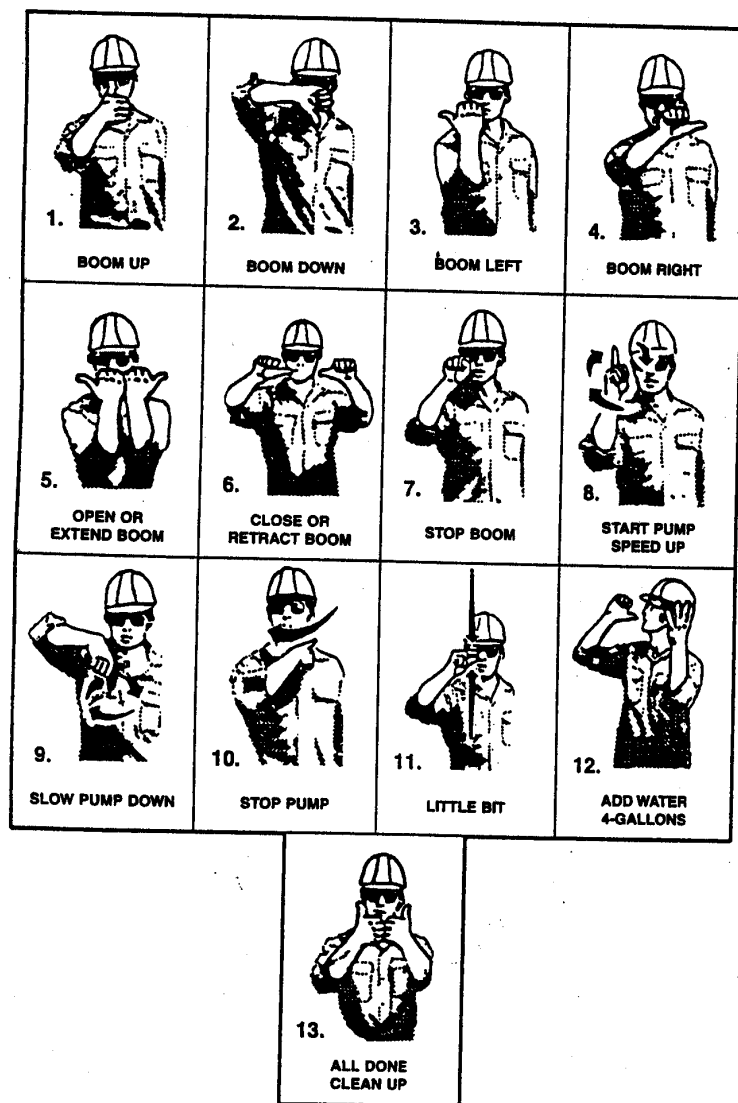

APPENDIX E

LIFTING CORRECTLY

MENTAL LIFTING

1. Lifting Everything Twice.

- First lift the load mentally.
- Plan every step carefully before you do it physically.

2. Size up the Load

- How much does it weigh?
- How much do you weigh?
- Can you lift it safely?

3. Get Help

- If the load is too bulky or heavy get help, don't do it alone.

4. Find a Better Way

- If the load is too large and heavy, arrange for mechanical help such as a pushcart, hand truck, wheelbarrow, forklift or crane.
- Anticipate problems you may encounter.

5. Check the Pathway

- Look for obstacles that might cause you to trip, slip, or fall.
- Check lifting, traffic (people and vehicles), and changes in elevation.

6. Solve Repetitive Problems

- Look for ways to reduce the number of times you have to lift.
- Don't lift and twist in the same motion.
- Use mechanical means whenever possible.

PHYSICAL LIFTING

Be sure to apply proper lifting techniques when working alone or as a team.

1. Lift it Properly

- Keep your back straight; tuck in your chin.
- Place your feet apart, one ahead of the other.
- Grip load with palm and fingers, not fingers alone.
- Bring load close to your body by tucking elbows in.
- Lift with your legs and arms, not your back.
- Compress your stomach muscles.
- Keep a clear view over load as you lift.

- Get help for bigger loads
- Use equipment to lift biggest loads.
- When turning, don't twist your back, instead turn you whole body as a unit.
- DO NOT LIFT AND TWIST IN THE SAME MOTION.



2. Team Lift



- Pick one person to call the signals.
- Walk in step.
- Lower the load together.

3. Push Don't Pull

- Use good lifting techniques when loading, use mechanical devices when possible.
- Push instead of pulling.
- When unloading use proper lifting principles.

4. Clear the Pathway

- Remove any hazards you see.
- Wipe up spills.
- Make sure area is well lighted.
- Wait until traffic clears.
- When traffic clears transport and unload using proper lifting principles.

APPENDIX F FIRE EXTINGUISHERS		WATER TYPE				FOAM	CARBON DIOXIDE	DRY CHEMICAL			MULTI-PURPOSE ABC
		STORED PRESSURE	CARTRIDGE OPERATED	WATER PUMP TANK	SODA ACID			SODIUM OR POTASSIUM DICARBONATE	SODIUM OR POTASSIUM DICARBONATE		
CLASS A FIRES WOOD PAPER TRASH HAVING GLOWING EMBERS	ORDINARY COMBUSTIBLES A										
		YES	YES	YES	YES	YES	YES	NO	NO	YES	YES
CLASS B FIRES FLAMMABLE LIQUIDS GASOLINE, OIL PAINT, GREASE, ETC.	FLAMMABLE COMBUSTIBLES B	NO	NO	NO	NO	YES	YES	YES	YES	YES	YES
		NO	NO	NO	NO	NO	YES	YES	YES	YES	YES
CLASS C FIRES ELECTRICAL EQUIPMENT	ELECTRICAL EQUIPMENT COMBUSTIBLE C	NO	NO	NO	NO	NO	YES	YES	YES	YES	YES
		NO	NO	NO	NO	NO	YES	YES	YES	YES	YES
SPECIAL EXTINGUISHING AGENTS APPROVED BY RECOGNIZED TESTING LABORATORIES											
METHOD OF OPERATION	COMBUSTIBLE METALS D	FULL PIN SQUEEZE HANDLE	TURN UP/DOWN AND BUMP	PUMP HANDLE	TURN UP/DOWN	TURN UP/DOWN	TURN UP/DOWN	FULL PIN SQUEEZE LEVER	FULL PIN SQUEEZE HANDLE	FULL PIN SQUEEZE HANDLE	RUPTURE CARTRIDGE SQUEEZE LEVER
RANGE		30' - 40'	30' - 40'	30' - 40'	30' - 40'	30' - 40'	30' - 40'	3' - 8'	5' - 20'	5' - 20'	5' - 20'
MAINTENANCE		CHECK AIR PRESSURE GAUGE MONTHLY	WEIGH GAS CARTRIDGE AND WATER IF REQUIRED ANNUALLY	DISCHARGE AND FILL WITH WATER ANNUALLY	DISCHARGE AND FILL WITH WATER ANNUALLY	DISCHARGE ANNUALLY RECHARGE	WEIGH SEM ANNUALLY	CHECK PRESSURE GAUGE AND CONDITION OF DRY CHEMICAL ANNUALLY	CHECK PRESSURE GAUGE AND CONDITION OF DRY CHEMICAL ANNUALLY	CHECK PRESSURE GAUGE AND CONDITION OF DRY CHEMICAL ANNUALLY	WEIGH GAS CARTRIDGE CHECK CONDITION OF DRY CHEMICAL ANNUALLY

APPENDIX F FIRE EXTINGUISHERS

APPENDIX G

HOW TO USE CONTAINER LABELS AND MSDS'S

HOW LABELS COMMUNICATE

Labels come in many formats. Some labels use words to describe the hazards and some use numbers and colors to help you quickly identify the kind and degree of hazard the chemical could present.

The labels you see may look slightly different from the samples we'll describe here, but they should have the same basic information.

ALWAYS READ THE LABEL FIRST

Always read the label before you move, handle, or open a chemical container. It has a lot of valuable information and instructions.

WHAT'S ON THE LABEL?

The label should always tell you:

- The name of the chemical.
- The name and address of the company that made or imported the chemical.
- The chemical's health hazards.

The label might also include:

- Important instructions for storing or handling the chemical.
- Protective clothing and equipment you should use when working with the chemical.
- Suggested safety procedures.

A LABEL TELLS YOU

The name of the chemical – the common name, chemical name, or both. If the substance contains more than one chemical, they will all be listed.


The name, address, and emergency telephone number of the company that manufactured or imported the chemical.

The chemical's physical hazards. What could happen if you don't handle it properly! Is it Flammable, Combustible, or Explosive? Is it Reactive or Radioactive?

The chemical's health hazards. The possible health problems that could result from over exposure. Is it toxic? An irritant? Could it cause cancer?

Some labels also include important information such as storage and handling instructions. This could include information like "use only in Well ventilated areas," or "store in tightly closed containers."

Basic protective clothing, Equipment and procedures that should be used to work safely with the chemical might also be listed. Here you might be told to "avoid contact with skin," or to use eye protection, etc.

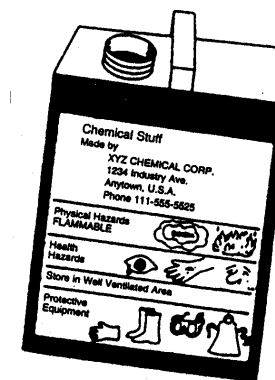

UNDERSTANDING LABELS

Chemical manufacturers, importers, and distributors must be sure that containers of hazardous chemicals shipped to their customers are labeled, tagged or marked with the identity, appropriate hazard warnings and the name and address of the manufacturer or responsible party.

Labels come in all shapes and sizes. The color bar type is one popular type of label.

Become familiar with the labels, symbols and numbers. Understand what they mean. It can help you avoid an accident.

COLOR BAR LABEL

NAME of chemical and ADDRESS of the manufacturer, importer or distributor of the chemical.

Potential impact on HEALTH

FLAMMABILITY: how easily the chemical burns.

REACTIVITY: what conditions and other chemicals the chemical can react with.

Any special protective equipment which should be worn or used.

Colors indicate the kind of Hazard

Red = FIRE

Yellow = REACTIVE

Blue = HEALTH HAZARD


The numbers show the degree or severity of that hazard

0 = Minimal; 1 = Slight Hazard; 2 = Moderate Hazard
3 = Serious Hazard; 4 = Severe Hazard

Chemical Name MFG • Address	
Health	Blue
Flammability	Red
Reactivity	Yellow
Personal Protection	White

NFPA TYPE PANEL LABEL

The National Fire Protection Agency label is another label type which also tells you a lot about the chemical it represents. The following tells you what the numbers and symbols mean:

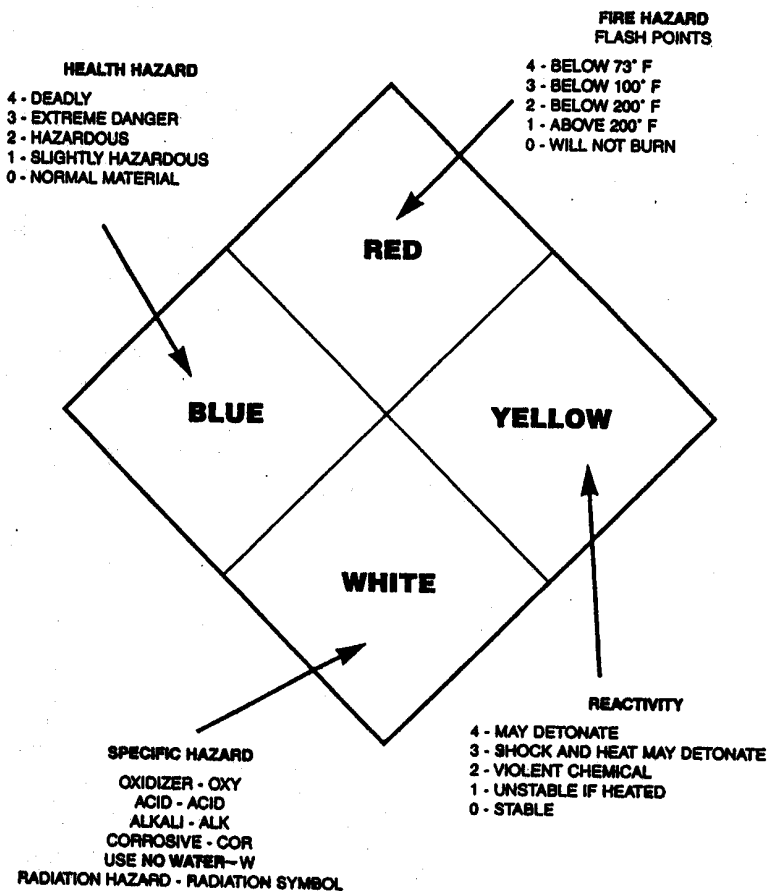

WHAT IS A MATERIAL SAFETY DATA SHEET?

The material Safety Data Sheet (MSDS) is the backbone of hazard communications. It gives details on chemical ingredients, chemical dangers, emergency response direction, and safety procedures. WA has at least one MSDS for every hazardous chemical in the workplace. The following example illustrates the basic information contained in a MSDS. Section numbers and headings can vary because there is no standard format requirement by OSHA.

1. Section 1 covers: who makes the chemical, address, emergency phone numbers, trade names, and (in most cases) the formula. When the formula is a trade secret, it is not disclosed, but the MSDS will still provide information on hazards and measures for safe handling.
 2. Chemical identification of components as well as exposure limit guidelines provided by ACGIH-TLV and OSHA-PEL are given in section 2.
 3. Physical Data includes: Appearance and odor under normal conditions, specific gravity, boiling point, vapor pressure, vapor density, and evaporation rate.
 4. Fire and Explosion: Indicates what kind of fire extinguisher to use, the flash point (temperature at which material ignites), special fire fighting procedures, and any special dangers.
1. ACGIH-TLV = American Conference of Government Industrial Hygienists – Threshold Limit Value
 2. OSHA – PEL = Occupational Health and Safety Administration Permissible Exposure Limit
5. Section 5 tells you what the chemical will react with, and if it does react, what might happen. It also tells you what situations to avoid so you don't get and unexpected chemical reaction.

MATERIAL SAFETY DATA SHEET

SECTION 1

MFG	Emergency Phone #
Address	Trade Name
Chemical	Formula

SECTION 2

HAZARDOUS INGREDIENTS

SECTION 3

PHYSICAL DATA

Appearance	Odor
Boiling Point	Specific
Gravity	
Vapor Pressure	Percent
Volatile	
Vapor Density	Evaporation
Date	
Solubility in Water	

SECTION 4

FIRE AND EXPLOSION DATA

Flash Point
Fire Extinguisher Media
Special Fire Fighting Procedures
Unusual Fire Hazards
Flammability Limits (by volume)

6. Entry

How the chemical can enter your body is covered in section 6.

This can include:

- Inhalation through the nose
- Eye contact
- Skin Contact
- Through mouth

Effect – what the symptoms might be

- Eye Irritation
- Rashes on skin
- Faintness
- Headache
- Nausea
- Irregular heart beat
- Aggravation of Existing medical condition
- Dizziness

First Aid

If the chemical is swallowed, inhaled or comes in contact with eyes or skin, this section of the MSDS gives emergency first aid procedures to follow:

7. This section covers what you should do if there is a spill or leak:

- What to do if there is a leak/spill.
- Equipment and procedures for cleaning up the spill.
- Method of disposal/special precautions.

8. Special Protection

To reduce the risk of harmful exposure, section 8 provides safety measures for adequate protection. You will find out what type of protection is required.

- Gloves
- Respirator
- Ventilation
- Eye Protection
- Protective Clothing


9. Special Precautions

Covers, special handling requirements like temperature, open sparks, humidity, and special containers. Some chemicals may require storage in special cabinets or refrigeration.

CHEMICAL LABELS


In addition to the Material Safety Data Sheet, the Hazard Communication Standards requires that the containers be properly labeled in the workplace and that your employer train you in how to read the labels and what special precautions are required.

The label may use words and/or symbols...

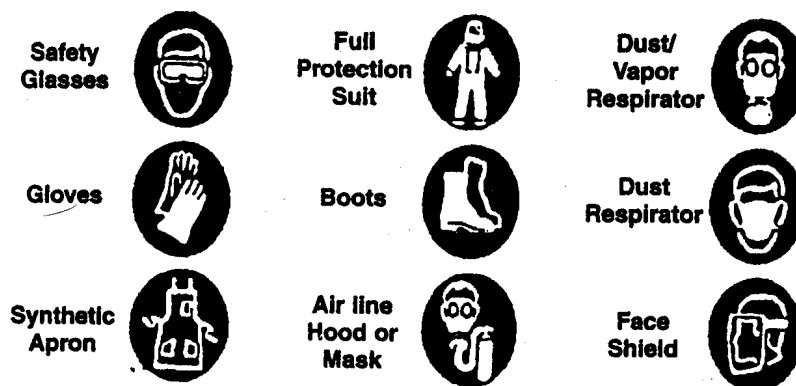

...to describe protective clothing which should be used when handling the chemical. The label should identify the chemical, the manufacturer, hazard severity, health hazard, and protective equipment needed.

Portable containers intended for immediate use (by employee who make the transfer) and pipes are not required to be labeled.

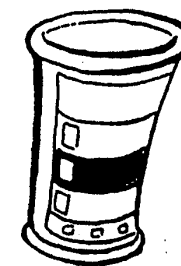


APPENDIX H

LADDERS

COMMON SENSE

- Place ladder on solid secure footing.
- Extend ladder when no one is on it.
- Adjust the length of an extension ladder only when your eye level is below level of locking device so you can see when lock is engaged.
- Always face the ladder when going up or down.
- Take one step at a time.
- Carry tools or other materials in tool pockets or attached to a tool belt.
- Raise and lower heavy materials with a rope.

- Move ladder to where work can be done without reaching far to either side of ladder.
- Keep the bottom of ladder free of materials, traffic, swinging doors, etc.
- Never leave ladders upright and unattended if children are around.
- Do not use ladders as guys, braces, gin poles, skids scaffolds, etc. or substitute for any use other than intended purpose.
- Never repair a ladder with improvised parts or techniques.

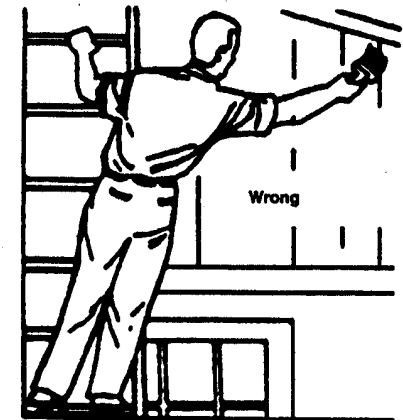

LADDERS MADE ON THE JOB

Manufactured ladders ("code" ladders) should comply with state and federal safety codes and standards.

Metal or other conductive ladders should be prohibited where the ladder or a worker using the ladder might come within 4 feet of electrical wiring or equipment.


Ladders placed where they could be moved or knocked over, should be protected by barriers or guards.

DO NOT USE DOUBLE HEADED NAILS. THE NAIL MUST BE DRIVEN DOWN ALL THE WAY.




LIGHT TRADES LADDERS REQUIREMENTS FOR

Length in feet	Rails in inches	Rungs in inches
Up to 12	2 X 3	1 X 3
12 – 20	2 X 4	1 X 3
20 – 26	2 X 6	1 X 4

Maximum Single Cleat • Maximum length – 24 feet
Width at top 15" minimum, 20" maximum

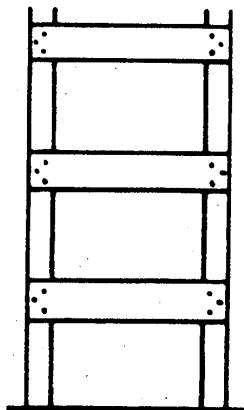

LADDERS MADE ON THE JOB

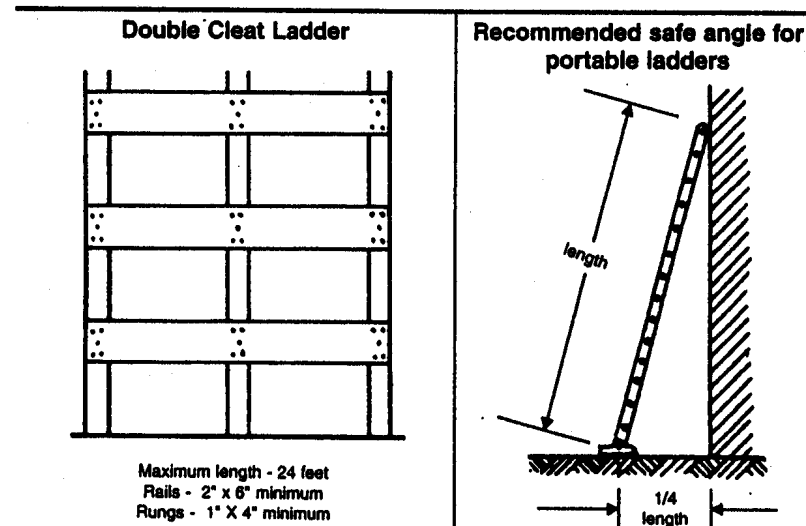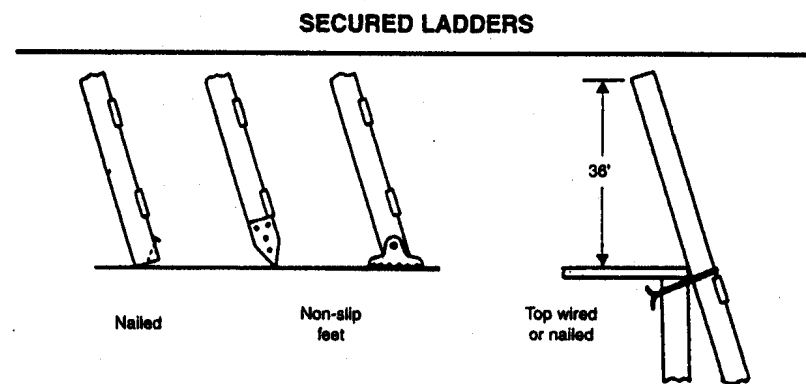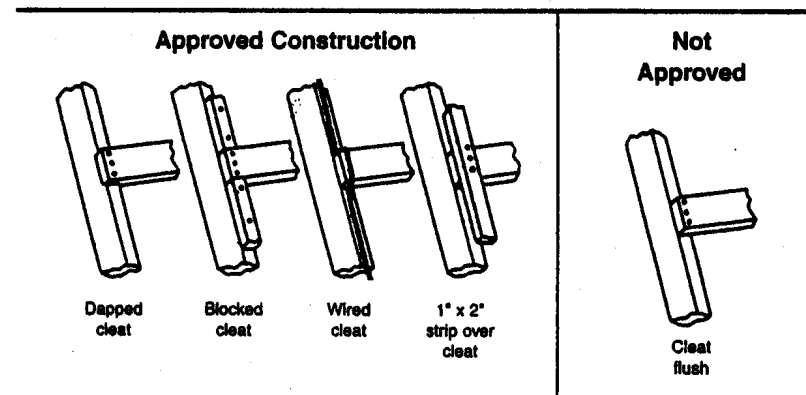


RUNS AND RISERS FOR STAIRS

(Run + Riser = 17-1/2")

Angle with Horizontal	Riser Inches	Run Inches
30° – 35°	6-1/2	11
32° – 08°	6-3/4	10-3/4
33° – 41°	7	10-1/2
35° – 16°	7-1/4	10-1/4
36° – 52°	7-1/2	10
38° – 29°	7-3/4	9-3/4
40° – 08°	8	9-1/2
41° – 44°	8-1/4	9-1/4
43° – 22°	8-1/2	9
45° – 00°	8-3/4	8-3/4
46° – 38°	9	8-1/2
48° – 16°	9-1/4	8-1/4
49° – 54°	9-1/2	8



MIDRAIL STANDARD

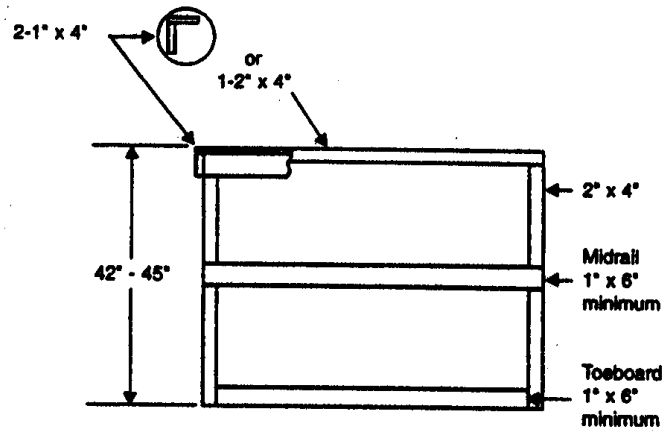

Use Material such as 2" x 4" or equivalent that will support 200 lbs in each direction. The posts shall not be more than 8 ft. apart. If using double hooded rails make certain the nail is driven all they way in.


PLATFORMS & STAIRWAYS

SAFE ANGLES FOR LADDERS, STAIRS AND RAMPS

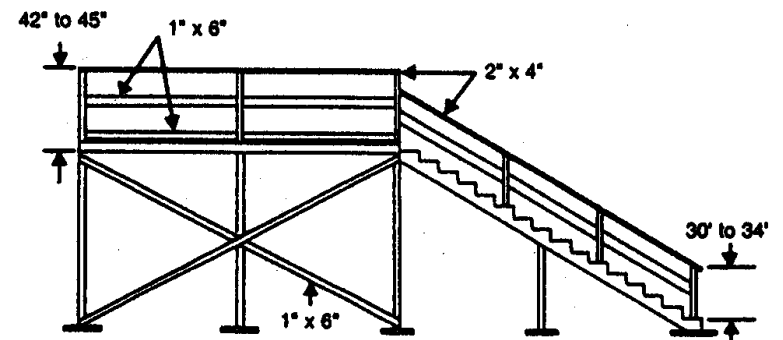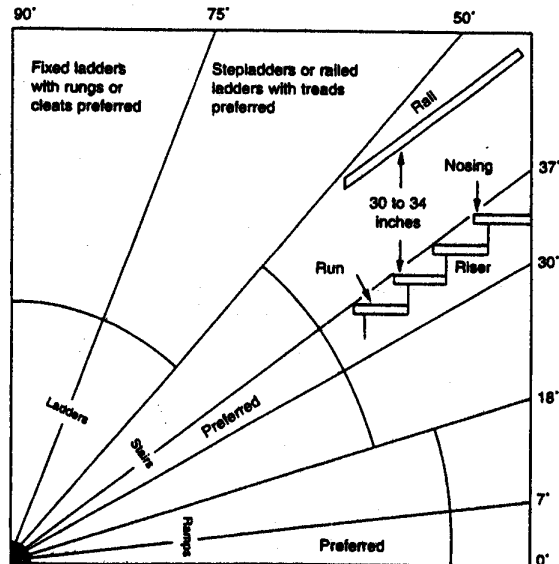

APPENDIX I

PROTECTIVE THROUGH FOR PROTRUDING REINFORCING STEEL

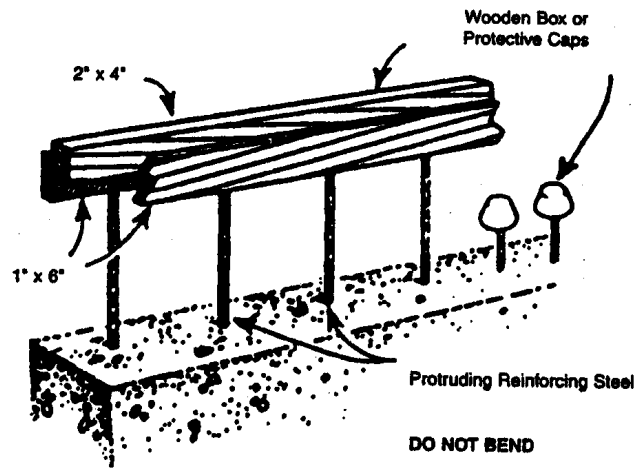

You may also tie a piece of rebar or wood next to the top whatever you use make certain it guards against impalement when working above rebar fall protection must be provided.

APPENDIX J

WHAT IS NOISE?

Noise is unwanted sound around us.

Noise can be generated from recreational activities: shooting, car racing, boating, etc.

Noise is also generated by many activities we perform around the house.

- Lawn mowing
- Chain sawing
- Vacuuming, etc.

We also have noise from our work activities:

- Air hammering
- Saws
- Punch presses
- Grinding, etc.

All noise can permanently decrease your ability to hear depending on how long, how loud and how often you are exposed.

HOW DOES YOUR EAR WORK?

Your outer ear consists of the Pinna and Auditory Canal. The Pinna and the canal collect and funnel sound waves generated in your environment to your ear drum.

Behind the eardrum, in the Middle Ear, are the three smallest bones in your body. These bones are called Ossicles. The Ossicles pick up vibrations from the eardrum and transmit them to the inner Ear.

The Inner Ear consists of fluid-filled passages containing thousands of microscopic nerve fiber, which respond specifically to the vibration entering the ear.

Impulses from these nerves fibers are sent to your brain and are registered as sound.

APPENDIX K

EMERGENCY CARE GUIDE

ACTIONS IMMEDIATELY FOLLOWING INJURIES HAVE SAVED LIVES – KNOW WHAT TO DO

CPR and first aid are often required when an emergency occurs.

Stop and assess the accident scene. Make sure you are not putting yourself in a dangerous situation.

IMMEDIATE ACTION


1. **BREATHING AND CIRCULATION:** If adult victim is not breathing, have someone call for help or call for help yourself before beginning mouth-to-mouth resuscitation. Begin CPR only if there is no pulse.
2. **BLEEDING:** Apply direct pressure at the wound and elevate it to stop persistent bleeding.
3. **SHOCK:** Lay the victim on his/her back and give assurance. Position the feet above the head. Monitor breathing and circulation.

If neck or spinal injuries are evident or suspected move the victim only if:

- a. It is necessary to establish or maintain a vital function such as breathing, or
- b. It must be done to avoid further injury.

FOLLOW-UP ACTIONS

1. **STAY CALM YOURSELF.**
2. **PROFESSIONAL MEDICAL HELP.** Have someone summon professional help unless you are alone with an unresponsive, unconscious adult victim. Then activate the Emergency Medical System (usually 911) before beginning rescue breathing.

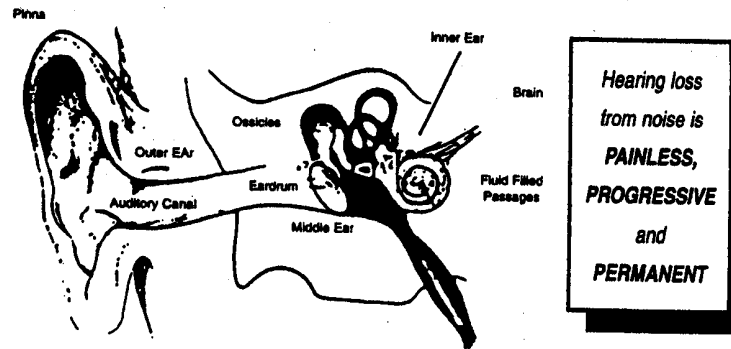


HOW DOES NOISE AFFECT YOUR HEARING?

Hearing loss occurs when the microscopic nerve fibers in the inner ear are damaged by prolonged exposure to excessive noise. This noise exposure can be on the job or off.

The hearing loss from noise occurs very slowly – first destroying the nerve fibers necessary for hearing high frequency sounds and gradually destroying nerve fibers necessary for hearing speech sounds.

Hearing loss from noise is, **PAINLESS, PROGRESSIVE AND PERMANENT!**

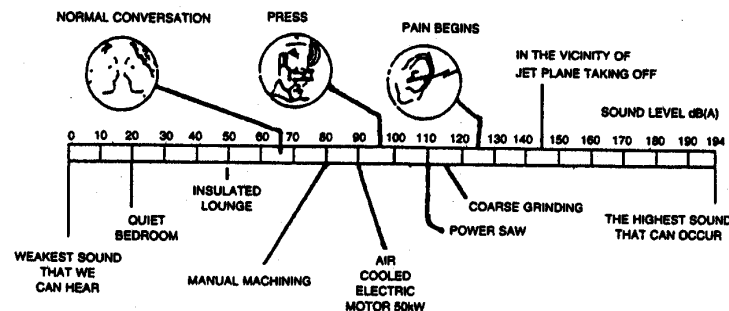

3. FOOD AND LIQUIDS. Never give unconscious or semiconscious victims food or liquids. They cannot swallow and might suffocate.

4. OTHER HEALTH PROBLEMS. Check the victim for emergency medical ID tags and medication.

**WHEN CALLING FOR
PROFESSIONAL MEDICAL HELP
REMEMBER**

First: Give the location. It is a good idea to mention something readily noticeable that will help them spot the scene.

Then: If feasible, give information about what happened, the number of injured persons, first aid given, and additional equipment needed.

**WHAT TO DO UNTIL HELP ARRIVES:
WHEN THEY HAVE STOPPED BREATING**

DETERMINE RESPONSIVENESS

- If the victim appears unconscious, gently shake a shoulder and shout: “Are you okay?”
- If no answer, have someone call Emergency Medical Service (usually 911) and proceed to ABC’s. If alone with an adult victim, call EMS before proceeding with ABC’s.

CONTACT WITH OR HANDLING OF BLOOD OR BODY FLUIDS MAY BE HAZARDOUS TO YOUR HEALTH. WEAR GLOVES; USE BARRIERS!

AIRWAY

- Roll the victim onto his or her back. Move the entire body as one unit.
- Open the airway by the head-tilt/chin-lift maneuver.
- Look, listen and feel for breathing for 3-5 seconds.
- If none, continue.

BREATHING, GIVE 2 FULL BREATHS

- Pinch the victim’s nose. Put your mouth over the victim’s mouth and make a good seal.
- Give 2 full breaths.
- Allow the victim’s lungs to deflate between breaths.

CIRCULATION. CHECK PULSE AND BREATHING

- Check the carotid pulse for 5 to 10 seconds.
- If there is a pulse but no breathing, give 1 breath every 5-6 seconds until the victim revives.
- In no pulse, begin CPR only if trained.

CHOKING

ADMINISTER THE HEIMLICH MANEUVER:

1. Ask: “ARE YOU CHOKING?” (Inability to breathe, cough, or speak indicates that the answer is probably yes.)

2. PERFORM THE HEIMLICH MANEUVER:

- Stand behind the victim.
- Wrap your arms around the victim’s waist and grab the fist of one hand with your other hand.
- Place the thumb side of your fist against the victim’s stomach slightly above the navel and below the rib cage.
- Thrust your fist into the victim’s abdomen with up to 5 quick, upward motions. If unsuccessful, reassess victim and technique repeat thrusts until effective.

BLEEDING

Contact with or handling of blood or body fluids may be hazardous to your health. Wear gloves; use barriers.

- Use direct pressure – apply pressure bandage.
- Maintain direct pressure – add another dressing if blood soaks through. Pressure points may be needed.

BURNS

- Burst blisters of second-degree burns could lead to severe conditions.
- Do not attempt to remove clothes attached to the skin.
- Cool the burnt area with cold water if there are no blisters or the skin is not broken.
- Keep victim lying flat and lightly covered.

POISONING

- Try to determine what was swallowed if victim is conscious.
- Call the Regional Poison Control Center and report the incident. Mention what and how much was taken (if known), the victim's condition and the name and location of the nearest hospital.

CHEST PAIN

- Help victim (if conscious) into comfortable position with the head raised. Loosen tight clothing.
- Help victim take prescribed medication if necessary.
- Activate Emergency Medical Service.
- Begin rescue breathing/ CPR if necessary.

CPR

Cardiopulmonary resuscitation – Perform only if you are trained!

- ONE – RESCUER adult CPR: Perform 15 external chest compressions at 80 to 100 times a minute (15 compressions to 2 breaths).
- After one Minute, check for carotid pulse.
- If no pulse, resume CPR.
- Check pulse, resume CPR.
- Check pulse every 4 cycles.
- Continue altering chest compressions and rescue breathing until advanced life support is available.

COLD EXPOSURE

Bodies are affected by outside temperatures. Water in our skin tissue can crystallize and freeze, causing abnormal function and sensation. Toes, noses, fingers, and ears are the most commonly affected areas. Frostbite and hypothermia are the two emergencies associated with cold exposure. Hypothermia can be life-threatening and must be treated immediately.

FROSTBITE

Signs and Symptoms

Cold, numb or painful skin that becomes hard and white as pain progresses.

Do Not

- Do not rub affected area.
- Do not break blisters.
- Do not give victim stimulants, including alcohol and tobacco.
- Do not leave victim alone (frostbite can lead to hypothermia, which can lead to death.)
- Do not use hot water.

What to do

- Move victim to a warm area.
- Put affected body parts in warm water (100° to 105° F) until skin becomes flushed.
- After warming, keep affected fingers and toes separated with gauze.
- Give warm fluids.
- If normal sensations haven't returned within 30 minutes, seek medical attention.

HYPOTHERMIA

Signs and Symptoms

Mild Hypothermia

- Shivering
- Loss of coordination
- Confusion
- Urge to urinate

Severe Hypothermia

- No longer shivering
- Stumbling
- Irrational behavior
- Slow, irregular heart beat

Do Not

- Do not leave victim alone.
- Do not use hot water to warm victim.
- Do not give hot liquids, alcohol, or anything by mouth.
- Do not allow the victim to move.
- Do not rub or manipulate the extremities.

Your goal is to minimize heat loss and add heat.

What to do

- Monitor the ABC's and Get help.
- Remove any wet clothes and submerge victim in warm water (100° to 105° F). Rapid warming is required. If unable to submerge victim, apply warm packs to neck, armpits, and groin. If water isn't available, use your own body heat to warm the victim.
- Stay with the victim and keep him or her warm, monitoring the ABC's until help arrives.
- If the victim must be moved, do so gently, keeping the victim in the horizontal position.

HEAT EXPOSURE

The body functions most effectively within a narrow temperature range. High temperatures increase the body's metabolic rate and decrease its efficiency. Loss of fluid and dilation of blood vessels occur in an attempt to cool down. The two major medical emergencies associated with heat exposure are heat exhaustion and heatstroke.

HEAT EXHAUSTION

Signs and Symptoms

- Sweating: moist, clammy skin
- Weakness and fatigue
- Nausea, vomiting
- Slightly elevated temperature
- Headache

Do Not

- Do not give victim any stimulant, including alcohol and tobacco.
- Do not apply ice directly to skin.
- Do not allow the victim to become so cold that he or she shivers.
- Do not leave victim alone.

What to do

- Remove victim from heat.
- Apply cool, wet cloths. Fan victim. Stop if victim develops goose bumps or shivers.
- If victim is conscious, give fluids. If possible, have the victim drink a mixture of 1 pint water with 1 teaspoon of salt every 30 minutes until person recovers.
- Seek medical attention if person doesn't continually improve.

HEAT STROKE

Signs and Symptoms:

- Hot, dry skin
- Red or spotted skin
- Extremely high body temperature
- Mental confusion
- Convulsions
- Loss of consciousness

Do Not

- Do not give fluids.
- Do not give victim aspirin or any other medication to lower fever.
- Do not give victim any stimulants, including alcohol and tobacco.
- Do not apply ice directly to skin.
- Do not allow victim to become so cold that he or she shivers.
- Do not leave victim alone.

What to do

- Remove person from heat.
- Remove victim's clothing and place him or her in a cool bath, if possible. Or apply cool compresses to body.
- Get medical attention immediately.

HEAT STRESS

The heat stress TLVs specified in table 2 & 3, refer to heat stress conditions under which it is believed that nearly all workers may be repeatedly exposed without adverse health effects. These TLVs are based on the assumption that nearly all acclimatized, fully clothed (e.g. lightweight pants and shirt) workers with adequate water and salt intake should be able to function effectively under the given working conditions without exceeding a deep body temperature of 38°C (100.4° F).

Where there is a requirement for protection against other harmful substances in the work environment and additional personal protective clothing and equipment must be worn, a correction to the WBGT TLV values, as presented in tables 1, 2 & 3 must be applied. The values in Figure 1 are approximations and are not intended as a substitute for physiological monitoring.

Since measurement of deep body temperature is impractical for monitoring the workers' heat load, the measurement of environmental factors is required which most nearly correlates with deep body temperature and other physiological responses to heat. At the present time, the Wet Bulb Globe Temperature Index (WBGT) is the simplest and most suitable technique to measure the environmental factors. WBGT values are calculated by the following equations:


TABLE 1

EXAMPLES OF PERMISSIBLE HEAT EXPOSURE THRESHOLD LIMIT VALUES {VALUES ARE GIVEN IN °C AND (°F) WBGT}*

Work-Rest Regimen	Work Load		
	Light	Moderate	Heavy
Continuous work	30.0 (86)	26.7 (80)	25.0 (77)
75% Work - 25% Rest, each hour	30.6 (87)	28.0 (82)	25.9 (78)
50% Work – 50% Rest each hour	31.4 (89)	29.4 (85)	27.9 (82)
25% Work – 75% Rest, each hour	32.2 (90)	31.1 (88)	30.0 (86)

For unacclimatized workers, the permissible heat exposure TLV should be reduced by 2.5° C.

TABLE 2

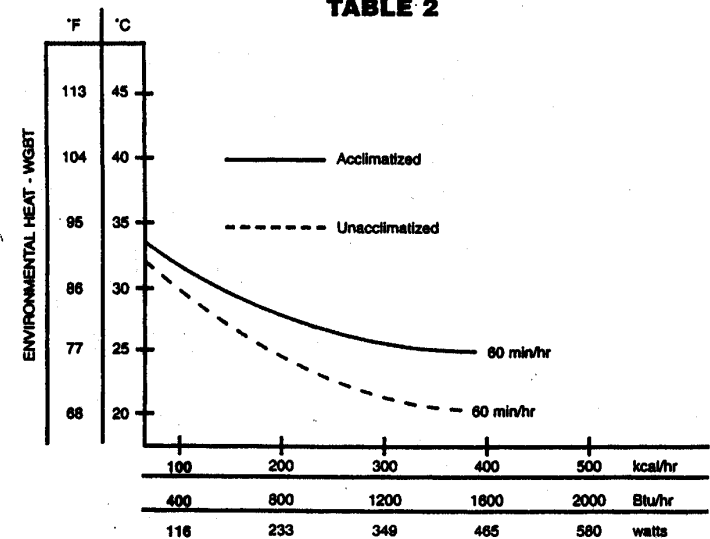

METABOLIC HEAT

Figure 1 – Permissible heat exposure Threshold Limit Values for heat acclimatized and unacclimatized workers.

TABLE 3

Index of Heat Exposures Stress (H.S.I.)	Physiological and Hygiene Implications of 8 hr. to Various Heat Stress
-20 -10	Mild cold strain. This condition frequently exists in areas where men recover from exposure to heat.
+0	No thermal strain.
+10 +20 +30	Mild to moderate heat strain. Where a job involves higher intellectual functions, dexterity, or alertness, subtle to substantial decrements in performance may be expected. In performance of heavy physical work, little decrements expected unless ability of individuals to perform such work under no thermal stress is marginal.
+40 +50 +60	Sever heat strain, involving a threat to health unless men are physically fit. Break-in period required for men not previously acclimatized. Some decrement in performance of physical work is to be expected. Medical selection of personnel desirable because these conditions unsuitable for those with cardiovascular or respiratory impairment or with chronic dermatitis. These working conditions are also unsuitable for activities requiring sustained mental effort.
+70 +80 +90	Very severe heat strain. Only a small percentage of the population may be expected to qualify for this work. Personnel should be selected (a) by medical examination, and (b) by trial on the job (after acclimatization). Special measures are needed to assure adequate water and salt intake. Amelioration of working conditions by any feasible means is highly desirable, and may be expected to decrease the health hazard while increasing efficiency on the job. Slight "Indisposition" which in most jobs would be insufficient to affect performance may render workers unfit for this exposure.
+100	The maximum strain tolerated daily by fit, Acclimatized young men.

WINDCHILL INDEX

Wind Speed in MPH	ACTUAL THERMOMETER READING (F)									
	50	40	30	20	10	0	-10	-20	-30	-40
Calm	50	40	30	20	10	0	-10	-20	-30	-40
5	48	37	27	16	-	-5	-15	-26	-36	-47
10	40	28	16	4	-9	-21	-33	-46	-58	-70
15	36	22	9	-5	-18	-36	-45	-58	-72	-85
20	32	18	4	-10	-25	-39	-53	-67	-82	-96
25	30	16	0	-15	-29	-44	-59	-74	-88	-104
30	28	13	-2	-18	-33	-48	-63	-79	-94	-109
35	27	11	-4	-20	-35	-49	-67	-82	-98	-113
40	26	10	-6	-21	-37	-53	-69	-85	-100	-116
Over 40 MPH (Little added effect)	LITTLE DANGER (For properly clothed person)				INCREASING DANGER			GREAT DANGER (Danger from Freezing of Exposed flesh)		

The human body senses "cold" as a result of both the air temperature and the wind velocity. Cooling of expected flesh increases rapidly as the wind velocity goes up. Frostbite can occur at relatively mild temperatures if wind penetrates the body insulation. For example, when the actual air temperature of the wind is 40° F (4.4°C) and its velocity is 30 mph (48km/h), the exposed skin would perceive this situation as an equivalent still air temperature of 13° F (-11° C).

APPENDIX L


SCAFFOLDING – GENERAL REQUIREMENTS

The maximum permissible spans for 2" x 10" or wider planks shall be as shown in the following:



	Full thickness Undressed			Nominal Thickness	
Working Load (lb/ft)	25	50	75	25	50
Permissible Span	10	8	6	8	6

METAL BRACKETS SCAFFOLDS (WALER JACK)

Brackets shall not be on walers held by wire ties unless there are at least three ties fairly close to each jack. Bolted walers are preferred where brackets are used.

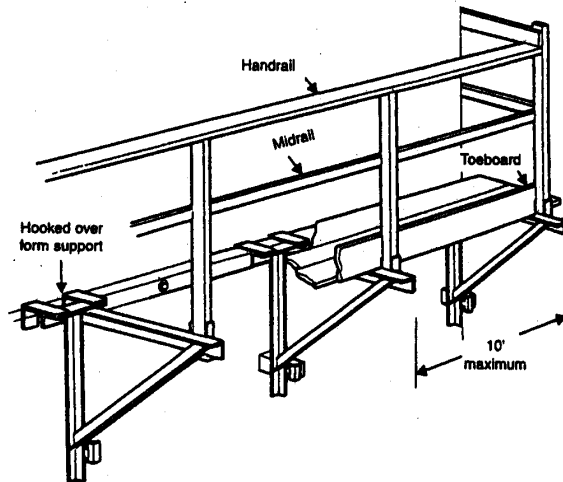

SET METAL SCAFFOLDING

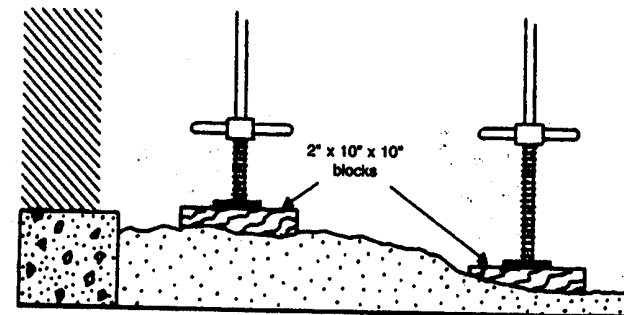
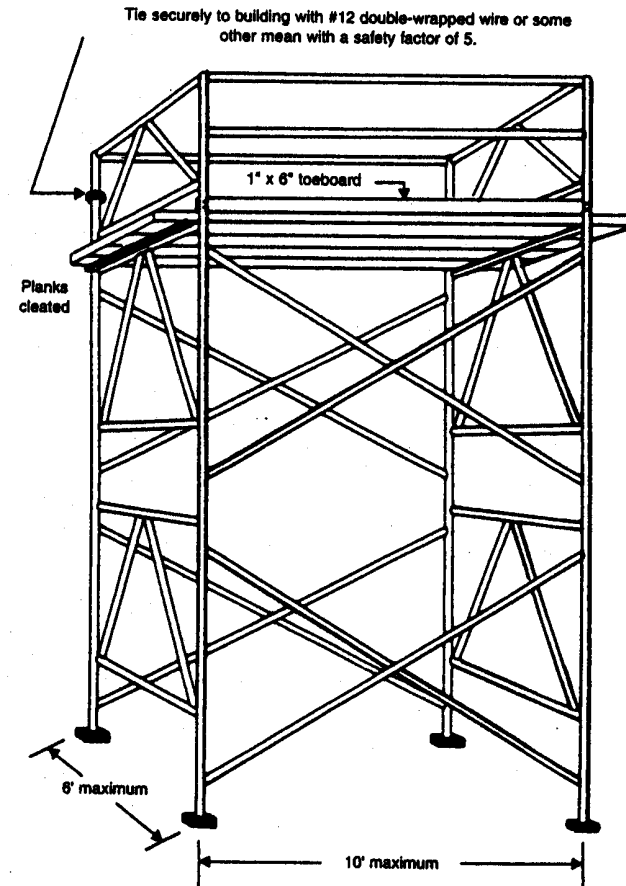


ROLLING METAL SCAFFOLDS


Rolling Scaffolds, when securely tied or guyed, shall be at least one-third as wide at the bottom as they are high.

Screw jacks shall extend into scaffold legs for at least one-third of their length. In no case shall more than 12 inches of the thread be exposed.

The uprights (legs of rolling scaffolds) shall not exceed 24 inches without being braced according to manufacturer's specifications.

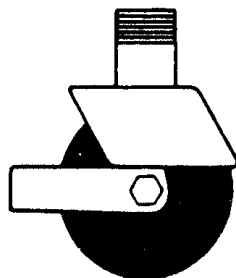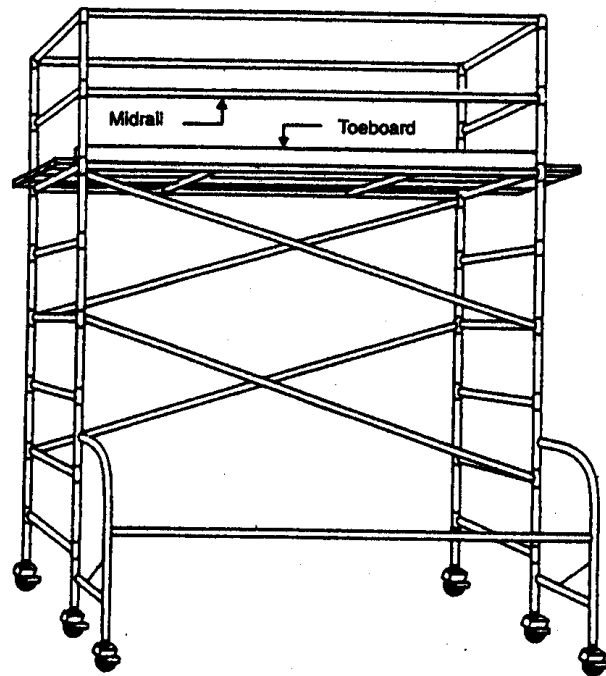

Caster Locked

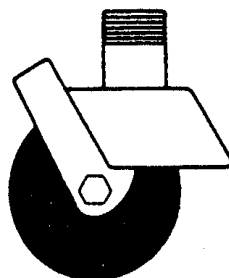

Caster Unlocked

APPENDIX M

EXCAVATION STANDARDS


B - 1.2 Excavations Made in Type B Soil



Simple Slope

1. All simple slope excavations 20 feet or less in depth shall have a maximum allowable slope of 1:1.


This bench allowed in cohesive soil only

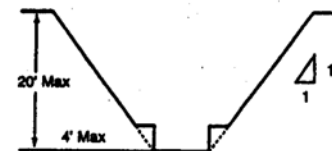

Single Bench

2. All benched excavations 20 feet or less in depth shall have a maximum allowable slope of 1:1 and maximum bench dimensions as shown above.


This bench allowed in cohesive soil only

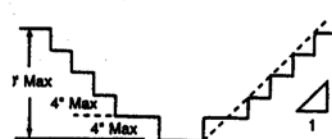

Multiple Bench

3. All excavations 20 feet or less in depth which have vertically sided lower portions shall be shielded or supported to a height at least 18 inches above the top of the vertical side. All such excavations shall have a maximum allowable slope of 1:1.


Support of shield system

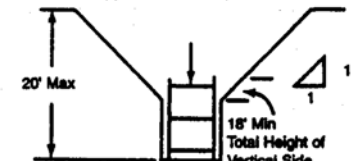

Vertically Sided Lower Portion

4. All other sloped excavations shall be in accordance with the other options permitted in § 1926.652 (b).


B - 1.3 Excavations Made in Type C Soil

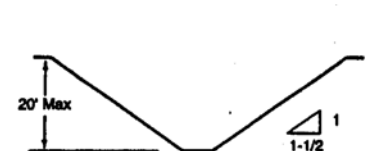

Simple Slope

1. All simple slope excavations 20 feet or less in depth shall have a maximum allowable slope of 1-1/2:1.

Support or Shield System

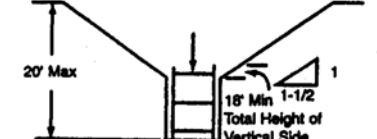

Vertical Side Lower Portion

2. All excavations 20 feet or less in depth which have vertically sided lower portions shall be shielded or supported to a height at least 18 inches above the top of the vertical side. All such excavation shall have a maximum allowable slope 1-1/2:1.
3. All other sloped excavations shall be in accordance with the other options permitted in § 1926.652(b).

MAXIMUM ALLOWABLE SLOPES

Soil or Rock type	Maximum Allowable Slopes(h:v) for Excavation less than 20 Feet Deep 1:3:1
Stable Rock	Vertical (90°)
Type A	3/4:1 (53°)
Type B	1:1 (45°)
Type C	1-1/2:1 (34°)

Notes:

1. Numbers shown in parentheses next to maximum allowable slopes are angles expressed in degrees from the horizontal. Angles have been rounded off.
2. A short term maximum allowable slope of 1/2H 1V (63°) is allowed in excavations in Type A soil that are 12 feet (3.67m) or less in depth. Short-term maximum allowable slopes for excavations greater than 12 feet (3.67m) in depth shall be 3/4H 1V (53°).
3. Sloping or benching for excavations greater than 20 feet deep shall be designed by a registered professional engineer.




Simple Slope - Short Term

Exception: Simple slope excavations which are open 24 hours or less (short-term) and which are 12 feet or less in depth shall have a maximum allowable slope of 1/3:1.




Unsupported Vertically Sided Lower Portion - Maximum 8 Feet in Depth

All excavations more than 8 feet but not more than 12 feet in depth which unsupported vertically sided lower portions shall have a maximum allowable slope of 1:1 and maximum vertical side of 3-1/2 feet.

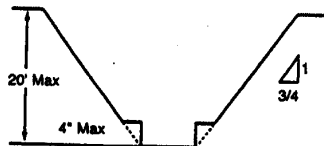

Simple Bench

2. All benched excavations 20 feet or less in depth shall have a maximum allowable slope of 3/4 to 1 and maximum bench dimensions as shown above.

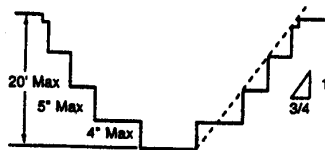


Multiple Bench

3. All excavations 8 feet or less in depth which have unsupported vertically sided lower portions shall have a maximum vertical side of 3-1/2 feet.



Unsupported Vertically Sided Lower Portion Maximum - 12 Feet in Depth

All excavations 20 feet or less in depth which have vertically sided lower portions that are supported or shielded shall have a maximum allowable slope of 1/4:1. The support or shield system must extend at least 18 inches above the top of the vertical side.

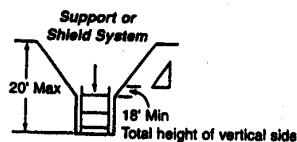


Supported or Shielded Vertically Sided Lower Portion

4. All other simple slope, compound slope, and vertically sided lower portion excavations shall be in accordance with the other options permitted under § 1926.652(b)

EXCAVATION MADE IN LAYERED SOILS

1. All excavations 20 feet or less in depth made in layered soils shall have a maximum allowable slope for each layer as set forth below.

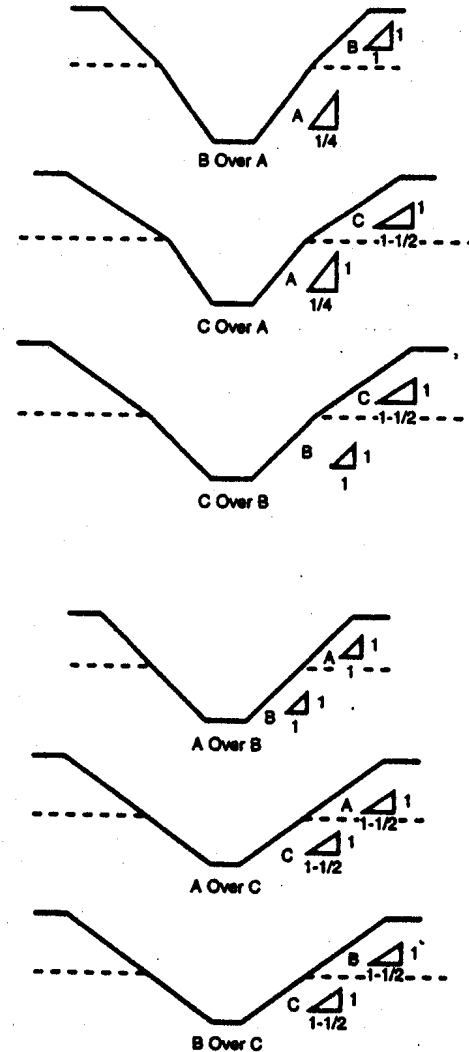

2. All other sloped excavations shall be in accordance with the other options permitted in § 1926.652(b).

APPENDIX N

DRUG INFORMATION GUIDE

Seven POSSIBLE symptoms of Drug Involvement:

1. Change in work attendance or performance.
2. Alteration of personal appearance.
3. Mood swings or attitude changes.
4. Withdrawal from responsibilities/family.
5. Association with drug using peers.
6. Unusual patterns of behavior.
7. Defensive attitude concerning drugs.

	Physical Symptom	Look For	Dangers
Alcohol Beer, wine, liquor	Intoxication, slurred speech, unsteady walk, relaxation, relaxed inhibitions, impaired	Smell of alcohol on clothes or breath intoxicated behavior, hangover, slowed reflexes, coordination	Addiction, accidents, overdose, heart & liver damage, glazed eyes
Cocaine Coke, rock, crack, base	Euphoria, elevated blood pressure & heart rate, restlessness, excitement	Glass vials, glass pipes, white powder, razor blades, syringes, needle marks	Addiction, heart attack, seizures, lung damage, severe depression, paranoia
Marijuana Pot, dope, grass, weed, hash, joint	Altered perception, red eyes, dry mouth, hunger, laughing, euphoria, reduced concentration & coordination	Rolling papers, pipes, dried plant material, odor of burnt hemp, roach clips	Panic reaction, impaired, short term memory, addiction
Hallucinogen Acid, LSD, PCP, MDMA, Ecstasy, Mushrooms, peyote	Altered mood, focus on detail, anxiety, nausea, panic	Capsules, tablets, 'microdots', blotter squares	Unpredictable behavior, emotional instability, violent behavior
Inhalants Gas, aerosols, glue, nitrates, Rush, white out	Nausea, dizziness, headaches, lack of coordination and control	Odor of substance on clothing or breath, intoxication, drowsiness, poor muscle control	Unconsciousness, suffocation, nausea, vomiting, damage to brain and nervous system, sudden death
Stimulants Speed, uppers, amphetamines, crank	Alertness, talkativeness, wakefulness, increased blood pressure, loss of appetite, mood elevation	Needle marks on arm, syringes, spoons, pinpoint pupils, cold moist skin	Fatigue, addiction, paranoia, depression, confusion, hallucinations
Depressants Barbiturates, Valium, sedatives, alcohol	Depressed breathing, and heartbeat, intoxication, drowsiness, uncoordinated movements	Capsules, pills, confused behavior longer periods of sleep, slurred speech	Overdose, muscle rigidity, addiction, withdrawal

APPENDIX O

WILKINSON ELECTRIC, INC INFORMATION RELATIVE TO MEDICAL PROVIDERS

(UTAH)

I agree to go to one of the following medical facilities provided by WCF as a first choice of medical treatment for any industrial injury/illness. I also understand if WCF lacks or refuses to provide medical treatment for an industrial injury/illness of if, for any reason, one of the approved medical facilities is not available for emergency care, I have the right to obtain the services of any qualified practitioner/doctor. In addition, I understand that failing to comply with the above statement could result in a possible denial of any claim taken against WCF for a work related injury/illness. I also understand that if I do not receive medical care for work-related injuries or illnesses from the employer designated provider, I can be financially responsible for that care.

Workers Compensation Fund of Utah
392 East 6400 South
Salt Lake City, UT 84107
1-800-446-COMP (2667)

Use IHC Work-med for all accidents, unless it is not possible to do so. If it is not possible, use any of the other preferred providers.

NOTE: At projects that are not easily accessed, the approved clinic will be posted on the job site emergency phone list.

INDEX

<u>Title</u>	<u>Page #</u>
Accident Reporting	30
Air Tools	9
Alcohol	2, 29-32, 90
Audio Equipment (See Tape Decks)	20
Boots	9
Clothing, boots and gloves	9
Clothing	9
Combustible Liquids	16
Company Rules.....	1
Compressed Gas Cylinders	9
Concrete Pumps	10-11
Concrete Shoring	10
Confined Space Program	10
Cranes	10-11
Cutting	27
Disaster Planning	12
Distribution of Literature	33
Drugs	2, 29-32, 90
Drug Policy, LCC	30-32
Ear Protection	8, 71-72
Edge Protection	12
Electrical	14
Emergency Care	73-83
Employee Responsibilities	29-30
Excavations	15, 87-89
Eye Protection	7-8, 34
Face Protection	7, 34
Fall Protection	8, 12-14
Fire Protection	16, 55
First Aid	18, 73-81
Flammable Liquids	16
Floor Openings	12
General Safety Guidelines	9
Gloves	9
Grinding	9
Guardrails	12
Hand Signals	50-52
Hand Tools	19

Hard Hats	6
Hazard Communication	16-17
Heating	23, 27
High Winds (See Disaster Planning)	12
Housekeeping	17
Injury Reporting	30
Job Foreman Responsibilities	28-29
Ladders	18, 64-68
Lifting Correctly	53
Lighting	18
Machinery	10-11, 19
Material Safety Data Sheets	60-63
Medical Providers	91-94
Medical Services	18, 91
Metric Conversions	46
Motor Vehicles	19
Power Tools	15, 19
Power-Actuated Tools	19
Protection – General Public	20
Protection – Noise	8
Protection – protruding Reinforced Steel	23
Protective Equipment	6-8
Radios – Tape Decks	20
Respiratory Protection	8
Riggings	36-40
Safety Belts	19
Scaffolding	20, 84-86
Solicitation	33
Storage Materials	22
Subcontractor Responsibilities	3-6
Tape Decks	20
Temporary Heating	23
Temporary Help	6
Theft	23
Toilets	23
Vandalism	23
Ventilation	24
Visitors (all)	6
Wall Openings	13
Weights & Measures	45-49
Welding	27
Workplace Violence	32

**ACKNOWLEDGEMENT OF
WILKISON ELECTRIC,
INC.
POCKET SAFETY
HANDBOOK**

I have read, or have explained to me,
the contents of the Wilkinson Electric,
Inc. Safety Handbook.

I understand the contents of this
handbook and that I am expected to
abide by Wilkinson Electric's rules and
regulations.

**I UNDERSTAND THAT THIS
HANDBOOK DOES NOT
CONTAIN ALL
STANDARDS OF CONDUCT
AND
SAFETY RULES**

SIGNATURE

DATE

PRINT NAME

SIGNATURE OF PERSON
WITNESSING AND/OR
REPRESENTING EMPLOYEE

DATE

TRAINING SESSION ON HAZARD COMMUNICATION

1. I know where the Material Safety Data Sheets (MSDS) for my work are kept.
2. I understand the safe work procedures and precautions to be taken when working with these products, including use of protective equipment and/or clothing.
3. I know where the emergency supplies are kept.
4. I know where the emergency phone numbers and Hazard Communication Information is posted.
5. I am aware that I may review copies of the Hazardous Chemical List, the Company's written program, and the MSDS.

SIGNATURE

DATE

PRINT NAME

SIGNATURE OF PERSON
WITNESSING AND/OR
REPRESENTING EMPLOYEE

DATE

SAFETY PYRAMID

